

Roger Williams University

DOCS@RWU

Historic Preservation Capstone Projects

Architecture, Art, and Historic Preservation
Theses and Projects

2016

Cultural Resource Survey of College Heights in Fredericksburg, Virginia

Kimberly Packett

Roger Williams University, kimberlypacket@gmail.com

Follow this and additional works at: https://docs.rwu.edu/hp_capstone_project

Recommended Citation

Packett, Kimberly, "Cultural Resource Survey of College Heights in Fredericksburg, Virginia" (2016).
Historic Preservation Capstone Projects. 14.
https://docs.rwu.edu/hp_capstone_project/14

This Thesis is brought to you for free and open access by the Architecture, Art, and Historic Preservation Theses and Projects at DOCS@RWU. It has been accepted for inclusion in Historic Preservation Capstone Projects by an authorized administrator of DOCS@RWU. For more information, please contact mwu@rwu.edu.

Cultural Resource Survey of College Heights in Fredericksburg, Virginia

Kimberly Packett

Master of Science

Historic Preservation

School of Architecture, Art and Historic Preservation

Roger Williams University

May 15, 2016

Cultural Resource Survey of College Heights in Fredericksburg, Virginia**Author:** _____**Kimberly Packett****date****Advisor:** _____**Catherine Zipf, Ph.D.****date****Reader:** _____**Jeremy Wells, Ph.D.****date****Dean of SAAHP:** _____**Stephen White, AIA****date**

TABLE OF CONTENTS

TITLE PAGE	i
SIGNATURE PAGE	ii
TABLE OF CONTENTS	iii
ABSTRACT	iv
LIST OF FIGURES	v
CHAPTER 1: INTRODUCTION	1
CHAPTER 2: METHODOLOGY	2
CHAPTER 3: HISTORICAL CONTEXT.....	5
CHAPTER 4: ANALYSIS OF COLLEGE HEIGHTS.....	19
4.1 Date of Construction	19
4.2 Primary Lot Use	20
4.3 Style.....	21
4.4 Architectural Significance	24
CHAPTER 5: NEIGHBORHOOD BOUNDARIES.....	26
5.1 Verbal Boundary Description	26
5.2 Boundary Justification	26
CHAPTER 6: RECOMMENDATIONS.....	28
BIBLIOGRAPHY	30
APPENDIX A	32

ABSTRACT

This cultural resource survey was conducted to determine whether or not the College Heights neighborhood in Fredericksburg, Virginia contains structures that have maintained their architectural integrity. First, I surveyed the 302 buildings that comprise the College Heights neighborhood. Next, I prepared a summary of the basic history of the area using sources from the local libraries and online. Finally, I analyzed the data from the survey and formed my recommendations. The data showed that the majority of the buildings in the College Heights neighborhood could be considered architecturally significant as they were good examples of mid-20th century modern architecture. My final recommendation was that further study was needed into the time period of the 1940s to the 1960s to see whether this neighborhood was historically significant during that period as well, and therefore eligible for the National Register.

LIST OF FIGURES

Figure 2.1	2
Figure 3.1	3
Figure 3.2	7
Figure 3.3	8
Figure 3.4	13
Figure 3.5	16
Table 4.1	19
Table 4.2	20
Table 4.3	21
Figure 4.4	22
Figure 4.5	23
Figure 4.6	24
Table 4.7	25
Figure 5.1	26

CHAPTER 1: INTRODUCTION

During the winter and spring of 2016, I conducted a cultural resource survey of the area of Fredericksburg known as College Heights. Fredericksburg is an independent city in the state of Virginia. College Heights is triangular in shape and bounded by four main roads: Jefferson Davis Highway, College Avenue, William Street, and Blue and Gray Parkway.

First, I conducted the survey using a form I created that included all the information the Virginia Department of Historic Resources (VDHR) deemed necessary. I went through the neighborhood on foot, filled in the information on the survey form for each property, and took multiple photographs of each as well. I then created an Excel spreadsheet for each property that contained the data from the field and photographs. The data from the forms was then transferred to a master database from which analysis could be drawn.

From this database, I discerned how many structures had maintained their architectural integrity. In this step, each structure was given a ranking in which style and date were taken into consideration to determine architectural significance. Once the significance of each building was determined, the entire database was analyzed to generate a summary of my findings. The results were used to identify any patterns or trends in those buildings that were architecturally significant in the neighborhood. The data collected and analyzed is architectural in nature only; historical data was not considered. My recommendation is to conduct further research on the College Heights neighborhood's mid-20th century history. Once the recommendation for the College Heights neighborhood was determined, it, the accompanying information, and the appropriate charts and photographs were compiled into this cultural resource survey report.

CHAPTER 2: METHODOLOGY

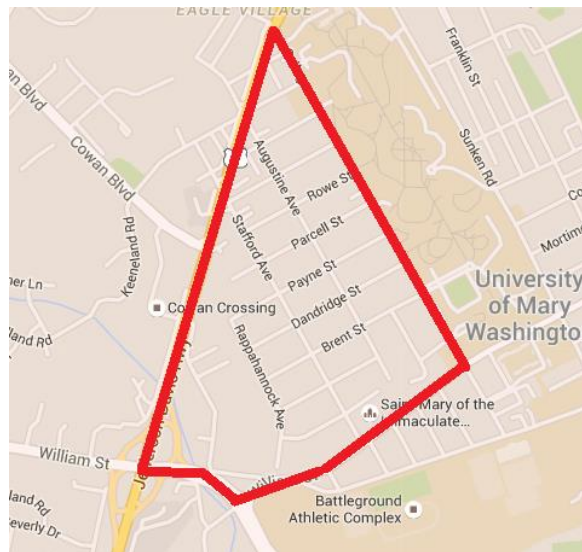


Figure 2.1: College Heights Neighborhood

The neighborhood of College Heights is located in the incorporated city of Fredericksburg, Virginia. It is triangular in shape and surrounded by four main roads. On the western side is Jefferson Davis Highway, also known as the Route 1 Bypass. To the east, the area is bounded by College Avenue and the University of Mary Washington. College Avenue and Jefferson Davis Highway intersect at a point to the North. The

south side of College Heights is bounded by William Street, which merges into Blue and Gray Parkway, also known as Route 3. Route 3 and Route 1 intersect at a point to the southwest of College Heights.

My cultural resource survey was conducted on College Heights to conduct preliminary research on the neighborhood's structures. The information I collected provided data regarding the styles of structures found in the region. Importantly, the survey was meant to identify buildings that maintained their architectural integrity.

First, I did a short reconnaissance survey in order to determine the number of structures in the area, as well as their overall styles. Then, I conducted the actual survey using a form I created that captured all the information recommended by the VDHR. A copy of the survey instrument is included at the end of this report (see Appendix A). The data from the forms was transferred to a master database from which an analysis could be drawn.

After the survey was complete, the next step was to research the history of the area in order to sketch the neighborhood's general development. My initial research focused on information regarding the overall context and the general background of the area. Through archival research that included books, census records, newspapers, deeds, etc., I learned the approximate date of when the area and most of its structures was created. I also consulted additional resources, including early editions of Fredericksburg's newspapers, *The Free Lance-Star*, the Fredericksburg City Directories for various years ranging from 1885 to 1938, the Fredericksburg Population Census Lists of 1850, 1860, 1870, and 1880, and Fredericksburg's Comprehensive Plan. These resources were found on Professor Gary Stanton's Fredericksburg Research Resource website.¹ Professor Stanton was a Historic Preservation professor at the University of Mary Washington for over 25 years before retiring in 2015. The resources found on Professor Stanton's page were edited from original scans in order to be accessible and readable to the public. Another online resource I used was the Fredericksburg's GIS website, which is run by employees of the City of Fredericksburg. This research was intended to provide context for understanding the architectural development of the College Heights neighborhood.

Once my survey and research were complete, each structure was given a rank that took style and date into consideration. Those structures which were regarded as maintaining their architectural integrity were labeled contributing, meaning that they were built within the time frame appropriate to their style and had not been significantly altered; they contribute to the architectural significance of the neighborhood. The last two classifications, non-contributing and demolished, were largely ignored, since these structures had either been built at a date that did not cohere to the style time frame or had been so significantly altered that the original fabric had

¹Gary Stanton, *Fredericksburg Research Resources*, last modified June 1, 2015, <http://resources.umwhisp.org/fredburg.htm>.

been completely changed. In the case of those buildings deemed demolished, the original structure was completely gone. The following chapters summarize my findings from both the survey and my research.

CHAPTER 3: HISTORICAL CONTEXT

College Heights is only one small section of the City of Fredericksburg, in Virginia. The first legal record of Fredericksburg as a community dates back to a patent executed on May 2, 1671. This patent was issued by Sir William Berkeley, his Majesty's Colonial Governor of Virginia. In it, 2,000 acres of land, known as Leaseland, were granted to John Buckner and Thomas Royston.² In 1727, Buckner and Royston took legislative action to survey and lay out the land in lots. The survey designated certain portions of land for a church, a market place, and a public wharf. It was at this time that the site was renamed Fredericksburg.³ Because people were not keeping to the original bounds and purchasers were building irregularly, the boundaries were re-surveyed in 1739. The General Assembly of Virginia passed an act in May, 1742, to establish these boundaries as the official "bounds of the city to be held firm and stable forever".⁴ The city would remain at these boundaries until 1759.

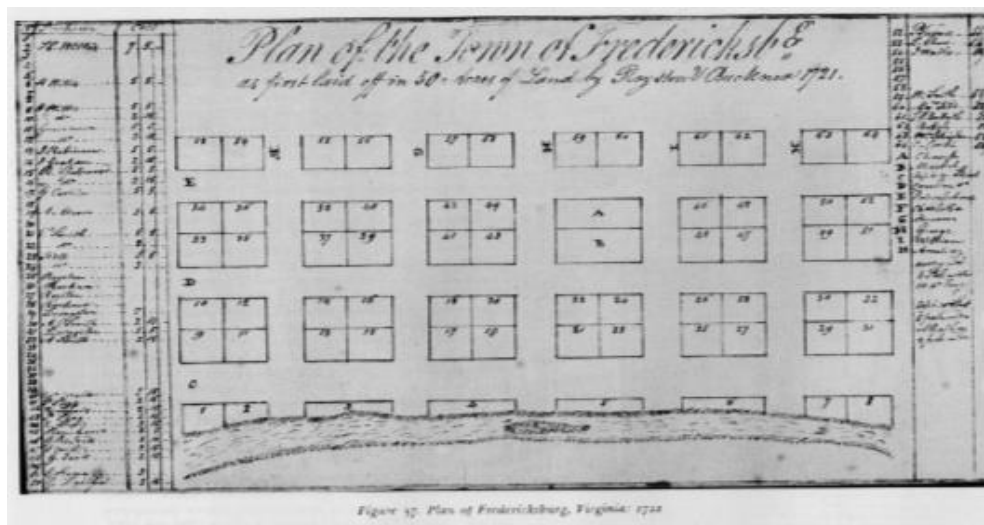


Figure 3.1: The plan for the City of Fredericksburg, 1721

² Edward Alvey Jr. *The Streets of Fredericksburg* (Fredericksburg, VA: The Mary Washington College Foundation Inc., 1978), 1-2.

³ Ibid, 4.

⁴ Ibid, 13.

Between 1671 and 1759, the city grew rapidly. By 1730, it had become the tenth largest shipping center in all North America. Bounded by the Rappahannock to the south, the city was able to utilize this resource to ship cargo to more than 125 ports and areas of the world and some 43 major towns and regions in North America. Geographically, the city was situated on the two main trans-colonial routes (the Trans-Seaboard Route and the Old Carolina Road) from the northern to the southern colonies. Thus, businesses and industries could find great financial success at this important crossroads. Many businesses were created, including iron works, merchandising, printing and publishing, salt works, and lumber industries. Additionally, a great variety of natural resources provided ample opportunities for the creation of plantations.⁵ Thus, the city became one of the ports of entry into Virginia and an attractive place to live and conduct business.

With the increase in population, the General Assembly established the Act of 1759 to enlarge the city. The city limits were extended northward to one block beyond Pitt Street, westward to Winchester Street, and southward. By 1782, another act was passed to extend the

⁵ Oscar H. Darter, *Colonial Fredericksburg and Neighborhood Perspective* (New York: Twayne Publishers, 1957), 85-90.

boundaries by a mile. Also due to the growth of Fredericksburg during this time, the General Assembly passed an act that provided for the election of officers and councilmen. The first mayor was Dr. Charles Mortimer.⁶ However, the 1780s also marked the peak of the city's prosperity.

The Revolutionary War had a significant impact on Fredericksburg's industry. The war started in 1775 and



Figure 3.2: The Hugh Mercer Apothecary shop in downtown historic Fredericksburg

ended in 1783. During this time, there was a need for the manufacturing of small arms. Thus, two major gunnery plants were built in Fredericksburg and were considered some of the finest iron works in North America. Ship building also became a major industry at this time. Apothecary shops were established as well, including the Hugh Mercer Apothecary, which is said to be one of the oldest drug stores in America.⁷

The Revolutionary Period was not only prosperous for business, but was also Fredericksburg's most populous era. The number of residents increased from 2,500 in 1750 to 6,000 by 1780. The population of the city almost doubled in number during the Revolutionary War alone. Because of the slave trade, the largest single group of residents in the city was African Americans and Mulattoes. The English were the second largest group, followed by the Scotch, French, and Germans. Fredericksburg was a diverse city and also included Irish, Welsh, Swiss, Dutch, Flemish, Italian, Russian, Polish, Spanish, and aboriginal Indian in its list of

⁶ Alvey, *The Streets of Fredericksburg*, 16.

⁷ Darter, *Colonial Fredericksburg*, 104-106.

inhabitants. The community also played a role in establishing religious freedom in Virginia.

While the city was dominated by Episcopalians, there were many Quakers, Presbyterians, Baptists, Methodists, Catholics, and Jews in the city.⁸ However, the city experienced a decline in the early 19th century.

The opening of the western part of the United States allowed many citizens from Fredericksburg to move westward in the early 1800s. Fredericksburg experienced a drop in population. In an effort to attract more people to the city, the General Assembly passed acts repairing streets and making charges necessary for the improvement, convenience, and well-being of the town. By 1851, the General Assembly had passed an act to extend the corporate limits once more, and by 1862, it had established public schools and police officers.⁹ The outbreak of the Civil War in 1861 greatly affected the residents of Fredericksburg. Many battles took place in and around the city and the city itself was often under fire. A major battle, the Battle of Fredericksburg, was fought from December 11 to December 15, 1862. This battle was the first historical event to occur in College Heights. During the battle, General Ambrose E. Burnside sent 100,000 Union men uphill against Robert E. Lee's 75,000 Confederate troops. Lee had dug his troops in behind a stone wall along Sunken Road, at the base of Marye's Heights. The ensuing battle resulted in heavy casualties and a Confederate victory.¹⁰ The Civil War inflicted much damage on the city and created many casualties. A

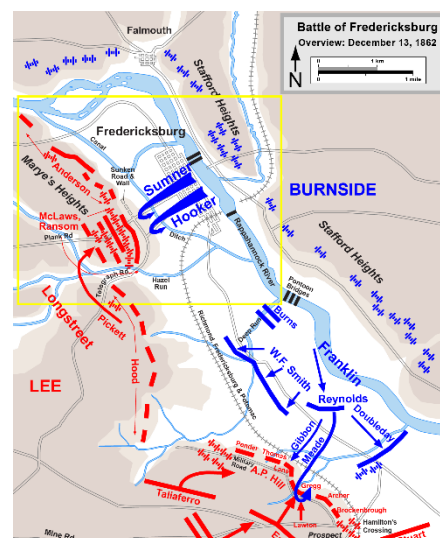


Figure 3.3: The Battle of Fredericksburg, December 13, 1862

⁸ Ibid, 111-113, 121.

⁹ Alvey, *The Streets of Fredericksburg*, 26-28.

¹⁰ Bill Goodwin, *Frommer's Virginia* (Hoboken, NJ: Wiley Publishing Inc., 2010), 116.

Union Cemetery was established at the top of Marye's Heights and a Confederate Cemetery was founded along William Street to accommodate the fallen.

After the war, the city once again focused on improving its amenities. In 1892, an act was passed to letter and number all the streets and residences. By 1904, the city had begun to pave Main Street and Commerce Street with granite blocks on a concrete foundation.¹¹ In the early 1900s, the commercial prosperity of Fredericksburg thrived. Main Street saw an increase in businesses and manufacturing institutions, including two large flouring mills, a wool mill, a silk mill, a shoe factory, and six repair shops. The advent of industrialism was behind the mechanization of the city as well as the first railway. The Richmond, Fredericksburg, and Potomac Railroad became the great line of travel from north to south. It was so popular that another track had to be added to the line.¹² Railroads became a crucial means of transportation and allowed people to move further away from their hometowns. Thus, the creation of College Heights was able to begin.

Built on a plateau, College Heights originally consisted mostly of woods. It was a popular place for hiking and picnicking for the residents of Fredericksburg. In 1891, streets and lots were laid off in the traditional street grid used by the city. During this time, College Avenue was a dirt road known as Avenue C. When the State Normal and Industrial School for Women opened in 1911, the street was improved with macadam, since the city wanted a better means of access to the institution from Plank Road, now William Street. As the college grew in size and prestige, interest in the area grew as well. Many residents looking for affordable housing close to the city of Fredericksburg moved in. However, College Heights was not officially part of the city until

¹¹ Alvey, *The Streets of Fredericksburg*, 38-40.

¹² Silvanus Jackson Quinn, *The History of the City of Fredericksburg, Virginia* (Richmond: The Hermitage Press, Inc., 1906), 327-328.

1940, when the city annexed a portion of it along Avenue C and one block to the west. Avenue C was widened, sidewalks were added, and curbs and gutters were built. The entire street was paved. It became the popular approach to the college from William Street, and it was at this time that the ornamental gateway was erected to the college at the intersection of Avenue C and Third Street, now Brent Street.¹³ On April 7, 1942, the city of Fredericksburg extended its boundaries to include the remaining part of College Heights along College Avenue.¹⁴ The streets of College Heights were lettered and numbered on January 10, 1950, to their present day names.¹⁵ The broad strip of land on both sides of the US 1 Bypass was annexed into the city in 1955, thus bringing the whole of College Heights into Fredericksburg.¹⁶

College Heights saw its period of significant development start in the 1920s. The majority of residents were of a working middle-class background. The demographic was mostly white, though there were many African-American residents as well.¹⁷ The creation of the College Heights Elementary High School in the fall of 1928 may indicate that most of the residents were newly joined couples or starter families. The school was reported to have eighteen classrooms, lavatories, a library, etc., and was located on the campus of the college. Open to children from the suburbs of Fredericksburg in Spotsylvania and Stafford counties, officials expected four hundred students to attend. One hundred of these students were high school level, while the remaining three hundred were elementary level.¹⁸ The overwhelming number of younger children may indicate that the families moving into the neighborhood were newly formed.

¹³ Alvey, *The Streets of Fredericksburg*, 61.

¹⁴ *Ibid.*, 69.

¹⁵ *Ibid.*, 61.

¹⁶ Paul Muse. "Zoning Code Under Increasing Criticism," Fredericksburg (VA) *The Free Lance-Star*, March 26, 1964, Section 1.

¹⁷ Chas. Insko Williams, "Fredericksburg, Virginia City Directory 1921," <http://resources.umwhisp.org/Fredericksburg/1921directory.htm> (accessed April 10, 2016).

¹⁸ "College Building Nears Completion," Fredericksburg (VA) *The Free Lance-Star*, September 4, 1928, Section 1.

The 1920s saw the increase of automobiles, which provided individuals with the ability to travel longer distances easily. This ease of transportation allowed people to move further away from cities without losing access to city resources. Additionally, the construction of the US 1 Bypass, or Jefferson Davis Highway, in 1927 also provided a better means of transportation from College Heights to surrounding areas. It even connected College Heights with Fredericksburg, since the original highway used Princess Anne Street up until the 1940s. After the 1940s, US 1 was split into one-way streets with Princess Anne and Caroline Streets, as it is today. In 1937, the highway eased travel even more by becoming multilane between Richmond and Petersburg.¹⁹ Therefore, College Heights became an accessible and attractive site for new families to build on. Many of the residences have attached or detached garages, signifying the presence and importance of automobiles in College Heights.

Architectural style choices, including Bungalow, American Foursquare, and Neo-colonial, as well as the presence of cars, indicate a primarily middle-class neighborhood. The dominance of these styles also reveals a demand for affordable housing. At this time, the Great Depression left many Americans without money, and thus, with the inability to construct new housing. Very little was built in College Heights between 1930 and 1940, as many Americans tended to share homes to cut back on costs.

After the Depression, College Heights experienced a period of rapid growth starting in the 1940s that didn't end until the 1970s. With the end of World War II, and the introduction of the GI Bill, veterans had enough money to buy new houses and live in the suburbs.²⁰ The increase in Cape Cod, Minimalist Traditional, and Ranch styles seen in College Heights in the

¹⁹ Dave Strong, "U.S. 1 and Branches," U.S. Highways Index, <http://www.vahighways.com/route-log/us001.htm> (accessed April 10, 2016).

²⁰ Ibid.

1940s and 1950s are evidence that many families moved into the area. By 1941, there were estimated to be four hundred residents in College Heights. The rapid increase is evidenced by the need for a new water tank and the demand for a new post office in the neighborhood. The Fredericksburg Post Office was established in the spring of 1941. It primarily served Mary Washington College, but it was also patronized by the nearby residents. The post office was constructed on College Avenue between Parcell and Rowe Streets.²¹ A new water tank was constructed in January of 1949 between College Avenue and Augustine Avenue, on the south side of Powhatan Street. The old tank had become inadequate, both because it could not supply enough water to the increasing residents and because it was too high to be served by the Fredericksburg city reservoir.²² A bus route also existed as early as 1949, which reveals the consistent need for transportation between Fredericksburg and College Heights.²³ The construction of the College Heights Community Swimming Pool in 1958 also reveals the family-oriented nature of the area.²⁴ The presence of split-level houses shows a slight climb in upward mobility starting in the 1960s.²⁵ These houses gave families a larger area of house without having to expand the property.

Fredericksburg experienced slow growth from the 1940s through the 1970s but exhibited an increase in growth rates in the 1980s, due to new development and annexation activities. During the course of the 1990s, the growth rate dropped significantly, most likely due to limited land available for development. In 2000, Fredericksburg was predominantly white, which made

²¹ "Branch Postoffice for College Section Planned," Fredericksburg (VA) *The Free Lance-Star*, February 7, 1941, Section 1.

²² "New Water Tank to be Ready Soon" Fredericksburg (VA) *The Free Lance-Star*, January 18, 1949, Section 6.

²³ "Bus Ad," Fredericksburg (VA) *The Free Lance-Star*, December 13, 1949, Section 8.

²⁴ "Filter Equipment Arrives for Pool; Opening Eyed," *The Free Lance-Star*, August 23, 1958, Section 2.

²⁵ Ibid.

up a total 73 percent of the population. African-Americans made up about 20 percent and other races made up about 7 percent. As of 2010, the white population has decreased slightly, while the percentage of African-Americans has increased.²⁶

Though historically residentially inclined, College Heights is a mixed-use neighborhood. The area was zoned to include residential, commercial, and industrial uses of the land. Much of the commercial zone is located along the US 1 Bypass. Churches are found mixed in with residences, though most occur along the major roads. Industrial use includes the old power plant that provided the college with heat, located along College Avenue. Residential zoning comprises most of College Heights.

However, residents have long been unhappy with the mixed use zoning of the neighborhood. The battle between residential and commercial development in College Heights dates to as early as 1961, when an economic report prepared by the state planning division revealed that of the 400 acres in the commercial zone, only 56 acres were actually in use. In 1964 residents began to organize to



Figure 3.4: University of Mary Washington Entrance

create a plan for Zone B, the buffer zone between residential and commercial areas. Residents pushed to have the commercial and buffer zone areas in College Heights replaced by a narrow B

²⁶ Fredericksburg Comprehensive Plan (2015), 22 <http://www.fredericksburgva.gov/DocumentCenter/View/5099> (accessed April 10, 2016).

Zone strip along the US 1 Bypass and bordering William Street businesses.²⁷ This rezoning would leave a 130-foot-deep strip that the residents hoped would ward off the possibility of commercial development. In particular, residents wanted to remove allowances for private clubs, lodges, boarding houses, tourist homes, hotels, motels, and free parking lots.²⁸ Residents complained that these establishments were directly across the street from blocks containing churches and homes.²⁹ As a result, commercial properties were restrained to the immediate border of the Bypass.

In 1976, however, even this small zone became a problem for many residents. A Pizza Hut, McDonald's restaurant, and new Pizza Box restaurant were constructed in the zone, though residents opposed them because of the noise disturbances they seemed to promote.³⁰ By 1978, the problem this commercial sector created on weekend nights had to be addressed. Residents complained that young people ranging from 12 to their early 20s would congregate on the edge of the neighborhood, attracted to the area by youth-oriented businesses, such as Pizza Hut, McDonalds, 7-Eleven, and Mary Washington College. From 10pm to 1am, residents were subjected to the sounds of people screaming, car doors slamming, loud radios, and tire squeals. The kids left behind trash on their lawns. At this time, some residents were forced to move. They blamed the businesses along US 1 Bypass for bringing in noisy people.³¹ However, while nothing could be done, residents continued to fight commercial development on a case-by-case

²⁷ Muse, "Zoning Code Under Increasing Criticism," Section 1.

²⁸ "Heights Residents Ask Broad Area's Rezoning," Fredericksburg (VA) *The Free Lance-Star*, March 11, 1964, Section 1,3.

²⁹ "College Heights Residents to Push Efforts on Zoning," Fredericksburg (VA) *The Free Lance-Star*, February 29, 1964, Section 3.

³⁰ William Lakeman, "Restaurant Served a Zoning Victory," Fredericksburg (VA) *The Free Lance-Star*, February 25, 1976, Section 17.

³¹ Larry Evans, "Where Kids, Problems Linger," Fredericksburg (VA) *The Free Lance-Star*, April 17, 1978, Section 1, 14.

basis. In 1982, residents successfully persuaded the City Planning Commission to refuse rezoning of the property at 1500 William Street for commercial use.³² Again in 1991, they protested the conversion of the old post office building into an open arts, dance, and video production studio.³³ The reasons for these objections included the potential for increased noise and traffic, parking limitations, and the concern that any approval of a commercial use building would lead to more commercial development in the area. The battle between residential and commercial use has continued to the present.

Similarly, residents have had problems with the University of Mary Washington for decades. Problems regarding the school were first seen in 1954 with the Mary Washington College heating plant. An outcry was raised over soot blackened windows, furniture, clothing, and cars, prompting the college to insert a new sprinkler system in the stack.³⁴ Generally, though, the neighborhood cites campus expansion and limited parking as the main problems. In 1984, the residents pushed the City Planning Commission to deny the Catholic Diocese of Arlington's request for a special use permit to move its campus facility to 1300 College Avenue. Residents maintained that the property should remain a single-family residence and that the ministry had plenty of room to expand at its present Brent Street site. Amongst a variety of reasons cited, they were most worried about increased parking congestion, vandalism, and a lack of supervision at the site. At this time, the college already had three off-campus religious facilities.³⁵

³² Rick Pullen, "Neighbors' Opposition Blocks Zoning Approval," Fredericksburg (VA) *The Free Lance-Star*, September 22, 1982, Section 1.

³³ "College Heights Permit Clash Unresolved," Fredericksburg (VA) *The Free Lance-Star*, September 6, 1991, Section 18.

³⁴ "College Heights Soot Licked By Installation, Officials Believe" Fredericksburg (VA) *The Free Lance-Star*, Jul. 20, 1954, Section 1.

³⁵ Keith Epps, "Residents Oppose Request by Church," Fredericksburg (VA) *The Free Lance-Star*, June 28, 1984, Section 16.

College Heights residents also had problems with student rentals in their neighborhood. Concerned with possible overcrowding and zoning violations, such as the rule that no more than three unrelated people can live in a house together, residents pushed for a resolution. The city responded by setting up a rental housing inspection program, which inspected rental houses to ensure safe living conditions, to make sure the zoning rules were being followed, and to make certain the building was being properly maintained. Parking still remained an issue, however. Residents complained that students took up too many parking spaces on the street.³⁶ Thus, in 1995, they proposed an amendment to the city code to establish residents-only parking on streets near the college. Presently, there is a ban on student parking in the College Heights neighborhood.

In addition to parking problems, College Heights has experienced traffic concerns as well. Many people used neighborhood streets to pass between the parallel roads of William Street and the US 1 Bypass. The construction of a shopping center along the US 1 Bypass also contributed to an influx of traffic. Thus, the city allowed residents to park on both sides of the street, hoping that the density would serve to calm traffic and



Figure 3.5: Saint Mary of the Immaculate Conception Roman Catholic Church on William Street

³⁶ Mike Voss, "College Heights Seeks Parking Ban," Fredericksburg (VA) *The Free Lance-Star*, June 26, 1995, Section C4.

prevent speeding by narrowing the wide streets.³⁷ The latest issue with traffic was in 2005 and involved the development of Cowan Boulevard. This road was meant to provide an easier route between Central Park and the US 1 Bypass. Residents were concerned that the road made it easy for people on Route 1 to access the neighborhood and frustrated that it actually inconvenienced their ability to make their own way onto the highway. They were also worried that it would increase the amount of traffic already using their streets to pass between the US 1 Bypass and William Street. In order to satisfy residents, the city designated traffic islands and installed faux brick crosswalks on Rowe Street and Stafford Avenue to mark the entrance to the neighborhood from the US 1 Bypass.³⁸ Presently, College Heights exhibits wide streets with residential on-street parking and sidewalks.

Finally, the churches and religious buildings in the neighborhood have also had a large impact on the development of College Heights. Fredericksburg has always shown a particular religious diversity. While Episcopalians dominated, Quakers, Presbyterians, Baptists, Methodists, Catholics, and Jews were all also present since colonial times.³⁹ Though not dating to the 18th century, College Heights also shows religious diversity in the neighborhood, including a Catholic Church, an Evangelical Church, a Lutheran Church and an Episcopal Church. Overall, the neighborhood has seemed to be accepting of the churches. However, residents do not want the churches to expand. In 2008, they protested the expansion of St. Mary of the Immaculate Conception Roman Catholic Church. This church, built on William Street in

³⁷ The City of Fredericksburg Comprehensive Plan (2007), 131.
http://www.fredericksburgva.com/uploadedFiles/Main_City_Content/Doing_Business/Files/Comp_Plan08_FINAL_LowResPhotos.pdf (Accessed April 10, 2016).

³⁸ Emily Battle, "Neighbors Fretting over Cowan," Fredericksburg (VA) *The Free Lance-Star*, July 20, 2005, Section B1, B8.

³⁹ Darter, *Colonial Fredericksburg*, 121.

1971, is one of the largest in the area. Residents cited traffic concerns and attempts to keep the neighborhood of a single-family residential character as reasons against the expansion. They also felt it important to set a precedent to deter church expansion for the future.⁴⁰ As of now, the expansion still has not begun.

The City of Fredericksburg's 2015 comprehensive plan highlights its desire to keep the character of its historic neighborhoods intact while also promoting their redevelopment. The plan also mentions the city's desire to increase homeownership within the city to a minimum of 40 percent.⁴¹ If the comprehensive plan is followed successfully, College Heights should retain its character and remain a predominately single-family, homeowner neighborhood.

⁴⁰ Jonas Beals, "Church's Plans are Worrying Neighbors," Fredericksburg (VA) *The Free Lance-Star*, August 21, 2008.

⁴¹ The City of Fredericksburg Comprehensive Plan (2015), 16-17.


CHAPTER 4: ANALYSIS OF COLLEGE HEIGHTS

All data is from a survey of the College Heights neighborhood I conducted in the winter and spring of 2016.

4.1 Date of Construction

This cultural resource survey of College Heights in Fredericksburg, Virginia, documents an area that went through a period of rapid construction. The chart below, titled Decades of Construction, shows that a building boom occurred between 1940 and 1960, with 116 of the neighborhood's total number of 302 buildings constructed in the 1950s. These statistics tell us that Fredericksburg experienced a great change in its population size during this time. The cause of this increase in population can be directly related to the end of WWII. With the end of the war came couples ready to settle down and start families. Fredericksburg was an ideal location for families starting up due to its proximity to work in the surrounding cities of Washington, D.C. and Richmond.

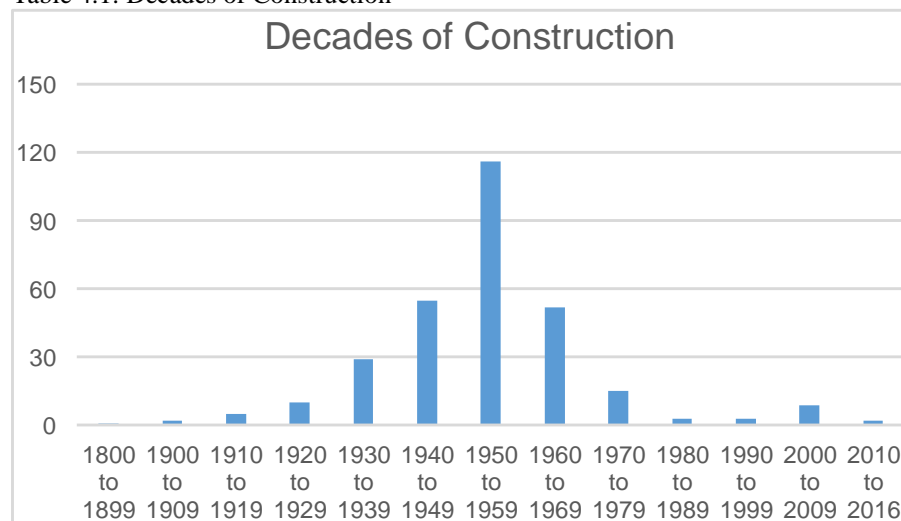Table 4.1: Decades of Construction




This chart also reveals a small increase in construction that occurred from 2000 to 2009. During this period, older homes were most likely demolished due to age, other problems, or the owner's preference, and these new homes were built to replace them. The number of newly constructed homes in the last six years is relatively low and there are no signs of planned new construction in the neighborhood.

4.2 Primary Lot Use

The use of the lots in the College Heights area has, for the most part, remained the same. The two charts below show the current use and the historic use of the area. The current use chart contains one additional use, academic, that is not seen on the historic use chart. The academic buildings in the neighborhood are being used by the University of Mary Washington.

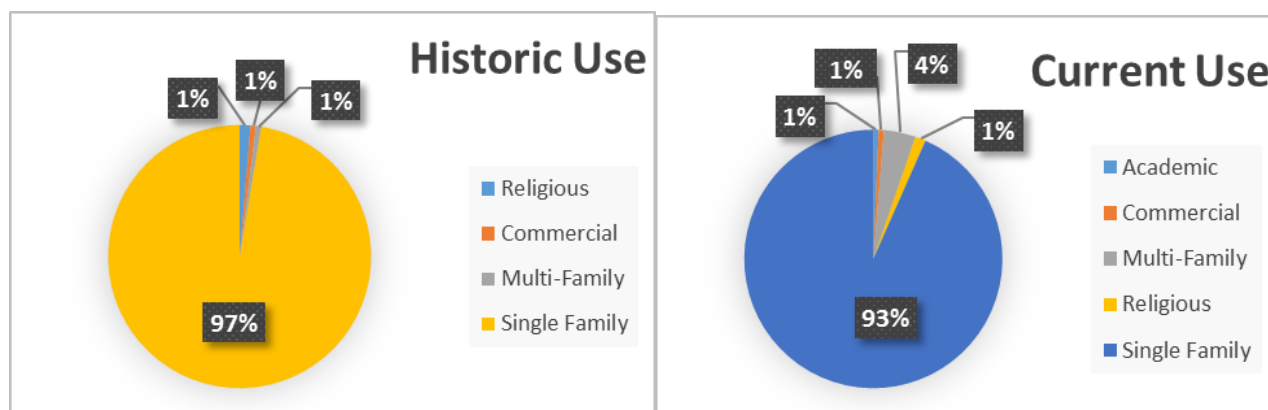Table 4.2: Use




Comparing the two charts shows a few differences between the two. While the main use of College Heights was, and is still, single family residences, there has been an increase in the number of multi-family housing in the area. Commercial and religious uses have remained the same over the years. The fact that there have not been any dramatic changes in the use of these lots shows that the original purpose of College Heights, which was to be a single family neighborhood, has been maintained through time.

4.3 Style

Among the 24 different styles existing in College Heights, some are more abundant than others. The graph below shows the different styles found in the neighborhood and the frequency in which they were found. Minimal Traditional, Cape Cod, Ranch, Neo-Colonial, and Colonial Revival are the predominant styles of the neighborhood.

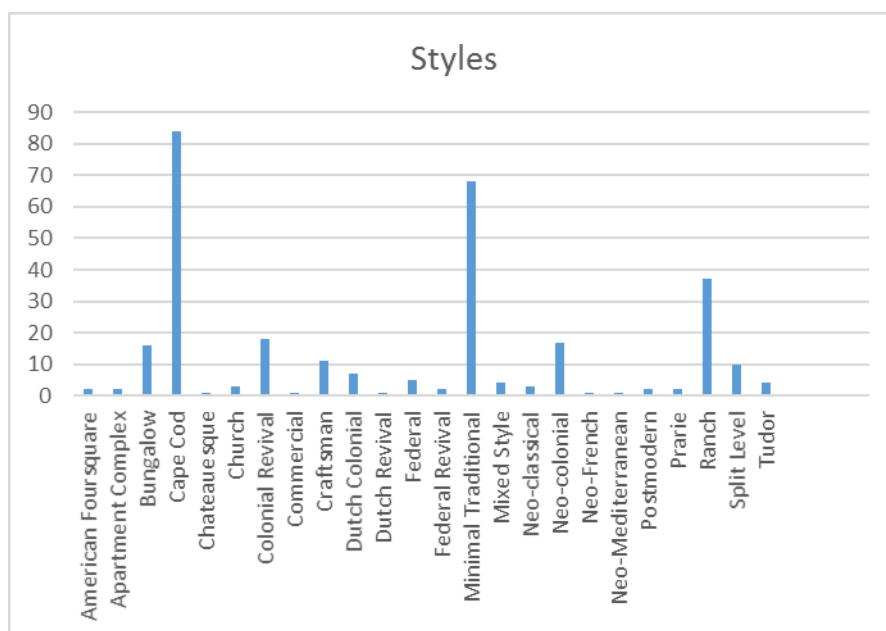Table 4.3: Styles



With over 80 buildings, Cape Cod is the most frequent style seen. Cape Cod is a style that was constructed in the area as early as 1932 and as late as 1995. The biggest periods for the construction of Cape Cods were the 1940s and 1950s, with 66 of the 84 Cape Cods being built between those years.



Figure 4.4: 1714 College Avenue, built in 1953.

Figure 4.4 shows 1714 College Avenue. This structure is in good condition and considered contributing because it represents a Cape Cod structure built during the highest period of construction of Cape Cod structures.

The second most abundant style in College Heights is Minimal Traditional. There were over 65 structures that were documented as Minimal Traditionals. Most Minimal Traditionals were constructed during the 1950s and 1960s, with 59 of the 68 structures being built between those years.



Figure 4.5: 1311 Dandridge Street, built in 1951.

Figure 4.5 shows 1311 Dandridge Street, an example of a typical Minimal Traditional home. This building is in good condition and was deemed contributing.

The third most abundant style seen in College Heights is the Ranch. The Ranch had its peak of construction in the 1950s and 1960s; 30 of the 37 Ranches in the College Heights neighborhood were constructed during this time. This trend may be due to the popularity of this style across the country at the time. Ranches were seen as a more modern style of home and set themselves apart from other styles in obvious ways. Ranch homes in College Heights have a distinctive rectangular floor plan and are one story.




Figure 4.6: 1320 Parcell Street,

Above is 1320 Parcell Street, built in 1949. An example of a Ranch style home with a modern feel. This structure was determined to be in good condition and contributing due to the popularity of this style during its construction.

4.4 Architectural Significance

When it came to determining whether a property was contributing or non-contributing in terms of architectural significance, the style, date of construction, and remaining original materials were taken into consideration. To be considered contributing to the architectural significance, the building had to be constructed within the time frame appropriate to their style and not significantly altered. If the building was built at a date that did not cohere to the style time frame or had been so significantly altered that the original fabric had been completely changed, the structure was deemed non-contributing. The chart below shows the number of structures that were considered contributing and non-contributing in College Heights.

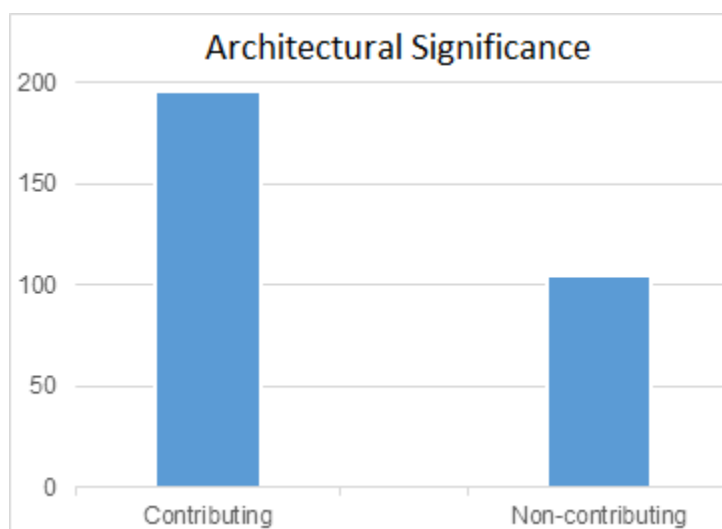Table 4.7: Architecturally Significance



67%, or 196 out of 302 structures, of College Heights can be considered contributing to the architectural integrity of the neighborhood. The most contributing structures date between the 1940s and the 1960s, when College Heights experienced the most growth. This period of time best represents the structures that are still remaining in the neighborhood today.

CHAPTER 5: NEIGHBORHOOD BOUNDARIES

5.1 Verbal Boundary Description

Starting at the Southeast corner of the neighborhood, the East boundary follows College Avenue north to Thornton Street. The North boundary follows one block of Thornton Street southwest, one block of Augustine Avenue southeast, and one block of Seacobeck Street southwest to the corner of Seacobeck Street and Stafford Avenue. The West boundary follows Stafford Avenue three blocks southeast to Payne Street, one block southwest along Payne Street, and five blocks along Rappahannock Avenue to the corner of William Street and Rappahannock Avenue. The South boundary runs along William Street from Rappahannock Avenue to College Avenue.

5.2 Boundary Justification

The College Heights neighborhood is defined by Route 1, College Avenue, William Street, and Route 3. After my reconnaissance survey of the area, I decided to reduce the neighborhood to the area you can see in figure 5.1. These boundaries include the properties that best exemplify the neighborhood's post war construction from the 1940s to the 1960s.

The area to the Southwest on the corner of Route 1 and Route 3 was not included in the Historic District due to the use and age of the structures. This area of predominately post 1980s commercial buildings would be

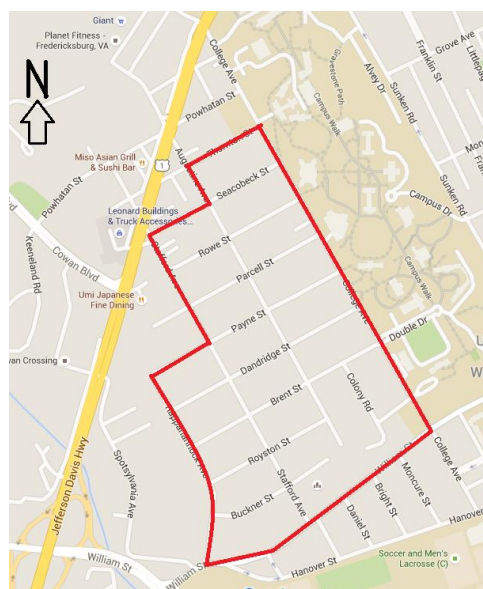


Figure 5.1 Historic District Boundaries

considered ineligible for a Historic District. The area to the North on the corner of Route 1 and College Avenue consists of three blocks of mainly industrial and commercial properties. I excluded these blocks because they were not residential structures.

CHAPTER 6: RECOMMENDATIONS

College Heights is a unique residential neighborhood. It contains examples of architecture that date from as far back as the early nineteenth century to as close as the present day, as well as a variety of styles for residential, religious, and academic structures. Since its initial period of growth in the post-World War II period, College Heights has experienced numerous changes to the character of its area. Beginning primarily as a small neighborhood on the outskirts of Fredericksburg, the expansion of the boundaries of Fredericksburg, population growth, and most importantly of all, the Route 1 Bypass has dramatically altered the historical context and use of the area.

As an excellent example of a mid-20th century neighborhood, I believe the College Heights neighborhood may be eligible for National Register Historic District status. This neighborhood is a prime example of the post-WWII growth that occurred in many cities around the United States, as soldiers returned from war and suburban life became the ideal for many young families. The neighborhood today still consists of many mid-century styles of homes, including Cape Cod, Ranch, and Minimal Traditional. This period of growth was an important time for both the City of Fredericksburg and the entire country.

While I feel that this neighborhood could be nominated to the National Register, the time period of construction, the 1940s to the 1960s, does not meet the 50 year minimum. Besides the age of the structures, the historical significance of this neighborhood has yet to be established. While I was able to conduct basic historical research on the City of Fredericksburg, and more specifically the neighborhood of College Heights, I was unable to conduct in-depth research into the historical significance of the neighborhood. Based on my survey and analysis, I recommend that this in-depth level of research be conducted on the history of the College Heights

neighborhood in the City of Fredericksburg, Virginia. Conducting interviews with residents, working with local preservation societies, and visiting archives in the surrounding areas will show whether this neighborhood has the historical significance needed to be considered for the National Register.

BIBLIOGRAPHY

- Alvey Jr., Edward. *The Streets of Fredericksburg*. Fredericksburg, VA: The Mary Washington College Foundation Inc., 1978.
- Battle, Emily. "Neighbors Fretting over Cowan." *The Free Lance-Star*, July 20, 2005.
- Beals, Jonas. "Church's Plans are Worrying Neighbors." *The Free Lance-Star*, August 21, 2008.
- "Branch Postoffice for College Section Planned." *The Free Lance-Star*, February 7, 1941.
- "Bus Ad." *The Free Lance-Star*, December 13, 1949.
- "College Building Nears Completion." *The Free Lance-Star*, September 4, 1928.
- "College Heights Permit Clash Unresolved." *The Free Lance-Star*, September 6, 1991.
- "College Heights Residents to Push Efforts on Zoning." *The Free Lance-Star*, February 29, 1964.
- "College Heights Soot Licked By Installation, Officials Believe." *The Free Lance-Star*, July 20, 1954.
- Darter, Oscar H. *Colonial Fredericksburg and Neighborhood Perspective*. New York: Twayne Publishers, 1957.
- Epps, Keith. "Residents Oppose Request by Church." *The Free Lance-Star*, June 28, 1984.
- Evans, Larry. "Where Kids, Problems Linger." *The Free Lance-Star*, April 17, 1978.
- "Filter Equipment Arrives for Pool; Opening Eyed." *The Free Lance-Star*, August 23, 1958.
- "Fredericksburg Comprehensive Plan." September 25, 2007.
http://www.fredericksburgva.com/uploadedFiles/Main_City_Content/Doing_Business/Fil es/Comp_Plan08_FINAL_LowResPhotos.pdf
- "Fredericksburg Comprehensive Plan." September 8, 2015.
<http://www.fredericksburgva.gov/DocumentCenter/View/5099>
- Goodwin, Bill. *Frommer's Virginia*. Hoboken, NJ: Wiley Publishing Inc., 2010.
- "Heights Residents Ask Broad Area's Rezoning." *The Free Lance-Star*, March 11, 1964.
- Lakeman, William. "Restaurant Served a Zoning Victory." *The Free Lance-Star*, February 25, 1976.

Muse, Paul. "Zoning Code Under Increasing Criticism." *The Free Lance-Star*, March 26, 1964.

"New Water Tank to be Ready Soon." *The Free Lance-Star*, January 18, 1949.

Pullen, Rick. "Neighbors' Opposition Blocks Zoning Approval." *The Free Lance-Star*, September 22, 1982.

Quinn, Silvanus Jackson. *The History of the City of Fredericksburg, Virginia*. Richmond: The Hermitage Press, Inc., 1906.

Stanton, Gary. "Fredericksburg Research Resources." Last modified June 1, 2015.
<http://resources.umwhisp.org/fredburg.htm>.



Strong, Dave. "U.S. 1 and Branches." *U.S. Highways Index*. Last modified September 23, 2013.
<http://www.vahighways.com/route-log/us001.htm>

Voss, Mike. "College Heights Seeks Parking Ban." *The Free Lance-Star*, June 26, 1995.

Williams, Charles Insko. "Fredericksburg, Virginia City Directory 1921." Last modified June 27, 2000.
<http://departments.umw.edu/hipr/www/fredericksburg/1921directory.htm>

APPENDIX A


Name of Surveyors			Survey Date	
ADDRESS	Street		Number	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
Current Use of Primary Building		Historic Use of Primary Building		
Style of Primary Bldg				
Number of Stories		Width (bays)		
Foundation Material		Depth (rooms)		
Year Built		Wall Cladding Material		
Roof Shape		Roof Material		
Decorative Details/Unique Features				
Evidence of Integrity Location/Materials				
Additions/Alterations to Primary Building				
Condition of Primary Building				code
Observable Threats				
Compatibility with Adjacent Land Uses				
Potential NR Eligibility				code
Other Comments / Salient Details				
Photo Views				
1	2	3	4	


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Brent	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	2 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1913	Wall Cladding Material	Hardboard Siding	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	White surround around doors and windows. Front gable on left side of house. Gable ends have decorative dark blue and white siding.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New windows, siding, and roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, style doesn't fit with surrounding houses			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Driveway on right side of the house. White picket fence around backyard. Brick front porch with white railings and a shed roof. Chimney on front of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Brent	Street	1218	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1948	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Two front gable dormers on front of house. White front gable portico with white columns above front porch. Black shutters on front bottom windows. White semi-circle pediment above door, transoms on either side of front door. White dentils along front of house.			
Evidence of Integrity Location/Materials	Original brick siding, front windows may be original.			
Additions/Alterations to Primary Building	Additions on right and back side of the house. Additions have vinyl siding. New roof.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Black iron fence around backyard. Brick stairs and path leading to brick front porch. Bushes along front of house. Brick stairs and path leading to back door. Chimney on right end of the original house.			

Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Colony	Street	1209-1219	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Apartment Complex		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Multi-Family	
Style of Primary Bldg	Apartment Complex			
Number of Stories	2	Width (bays)	8	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Flat	Roof Material	Asphalt	
Decorative Details/Unique Features	White pediment above doors. Brick lintel above windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	None visible.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Poor, surrounded by single family homes			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement path and stairs leading to all doors. Bushes and flowers along base of building. Interior chimney in back left side of the apartment complex.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Colony	Street	1111a and 1111	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Semi circular transom on front of roof. Black shutters on front windows. Two small windows on either side of front door. Portico with a metal curved hip roof over front door with green columns. Green surround around front door and green windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	Attached garage renovated into a separate apartment. New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Brick path and step leading to front door. Bushes along front of house. Covered pathway leads to 1111a a separate apartment. Interior chimney on right side of house. Short green wood fence around backyard. Double driveway in front of 1111a. Black and gold lamppost on front lawn. Green wooden stairs on right side of house lead to side door.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett	Survey Date	3/26/2016
ADDRESS	Street	Number	
	Buckner Street	1204	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Colonial Revival		
Number of Stories	2	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1985	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Brick lintel above front door and bottom windows. Green shutters on front windows.		
Evidence of Integrity Location/Materials	Original brick siding, windows, and roof.		
Additions/Alterations to Primary Building	None.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Non-contributing	code N	
Other Comments / Salient Details	Driveway on left side of the house. Brick path and stairs with white iron railing leading to front door. Bushes along brick path and base of the house.		



Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1104	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape cod			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Brick	Depth (rooms)	3	
Year Built	1935	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Slate	
Decorative Details/Unique Features	Green shutter on bottom windows. White front gable portico above front door. Two front gable dormers on front of roof. Central chimney and chimney on right end of the house. White surround around front windows.			
Evidence of Integrity Location/Materials	Front windows may be original.			
Additions/Alterations to Primary Building	Addition on rear of the house. New siding and roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Cement retaining wall along front and side of house. Ivy along retaining wall. Brick path and stairs with an iron railing leading to front door. Bushes along front of house. Cement stairs with iron railing and path leading to side door.			
Photo Views				
1 Side View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1108	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Brick	Depth (rooms)	4	
Year Built	1925	Wall Cladding Material	Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with three windows on front of house. White surround around front door. Roof extends and hangs over front porch with brick bottomed/siding on top pillars.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Good		code	G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Brick retaining wall along front of property and sides of driveway. Dirt and gravel driveway on left side of the house. Cement path leading from driveway to front porch. Chimney on left end of the house. Shed in backyard. Bushes and flowers along driveway and house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1110	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1939	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front first story windows. White pilasters and entablature around front door. Two front gable dormers with windows on front of roof.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good			code G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Central chimney. Cement driveway on left side of the house. Cement path leading from sidewalk to brick stairs with iron railings leading to front door. Shed in the backyard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1202	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1939	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Light blue front door and shutters on first story windows on front of house. Brick siding has been painted white. Two front gable dormers on front of roof with vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	Addition on the rear of the house. New roof.			
Condition of Primary Building	Poor		code	P
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Chimney on left end of house. Cement driveway on left side of house. Cement path leading from sidewalk to stone steps with black iron railing leading to front door.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1206	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front first story windows. White surround around front door. Two front gable dormers with vinyl siding on front of roof.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair			code F
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Dirt and gravel driveway on left side of the house leading to detached garage in backyard. Cement path leading from sidewalk to brick stairs with iron railing leading to front door. Chimney on left end of the house. Lamp post in front lawn.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1210	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1943	Wall Cladding Material	Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around windows. White crown above red front door with green shutters. Two front gable dormers on front of roof.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New roof, siding, and windows.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement and brick driveway on left side of the house leading to detached garage in backyard. Brick and stone path leading from sidewalk to brick stairs with iron railing leading to front door. Central chimney.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1214	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1941	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Slate	
Decorative Details/Unique Features	White and black decorative shutters on front windows. White crown and pilasters around front door. White shingle siding on gable ends.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick driveway on left side of the house leading to carport in backyard. Brick path leading from sidewalk to brick stairs with iron railing leading to front door. Bushes along front of the house. Chimney on right end of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Dutch Colonial			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Gambrel	Roof Material	Slate	
Decorative Details/Unique Features	Brick siding on first story, vinyl siding on second story. White surround around front windows. Black shutters on front windows. Front gable tan portico with tan columns above front door landing. Extended shed dormer with four windows on front of house.			
Evidence of Integrity Location/Materials	Original brick siding. Possibly original slate roof.			
Additions/Alterations to Primary Building	New vinyl siding and windows.			
Condition of Primary Building	Good			code G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Stone path leading from sidewalk to brick stairs and landing in front of front door. Wood privacy fence around backyard.			
Photo Views				
1 Front View	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	College	Avenue	1004	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Academic Building		1	
Current Use of Primary Building	Academic	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1975	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Blue shutters on front windows. Front gable on front of house with decorative circular window. Vinyl siding on rear addition, with a gable roof, that was converted from a garage to a livable space. Tan broked pediment and pilasters around front door. Sidelights on either side of front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof, attached garage on rear of house was converted into a livable space.			
Condition of Primary Building	Excellent			code E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Poor, surrounded by residential buildings.			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick retaining wall along front of property. Brick stairs and path with iron railing leading to front door. Brick path leading from sidewalk to side door. Lamp post on side of property. UMW sign in front yard.			
Photo Views				
1 Front View	2 Side View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1201	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Academic Building		1	
Current Use of Primary Building	Academic	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neoclassical			
Number of Stories	2	Width (bays)	7	
Foundation Material	Concrete	Depth (rooms)	7	
Year Built	2003	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Slate	
Decorative Details/Unique Features	Two front gable dormers on back right side of house. Front gable two story portico with columns above on front of house. Decorative circular window on front gable portico. Black shutters on front window. Decorative keystone above windows and doors. Transom and sidelights around front door, transom above side door. Small white balcony above front door with iron railing. Front gable has white vinyl siding. Decorative brick lintels above windows and doors.			
Evidence of Integrity Location/Materials	Original brick siding, windows, and roof.			
Additions/Alterations to Primary Building	Attached garage on rear of house has been converted into a livable space. Previous garage door spaces have vinyl siding.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Compatible with UMW across the street, not compatible to surround residential buildings.			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Brick stairs and path with iron railing leading to brick front porch. Brick driveway on right side of house leading to attached garage that has been converted into a livable space. Brick stairs with iron railing leading to side door. Bushes along base of house and front pathway. Interior chimney on left side of house. End chimneys on right and left side of house.			
Photo Views				
1 Front View	2 Side View	3	4	





Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1203	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1969	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan crown and pilasters around front door. Green shutters on windows. Tan crown above first story windows. Tan surround around second floor windows. Brick window sills below first story front windows.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original vinyl siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	Cement driveway on right side of house leading to attached garage. Cement path leading from driveway to brick stairs with white iron railing leading to front door. Small bushes along front of house. Chimney on right end of house. Wood privacy fence around backyard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1205	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1975	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Tan vinyl siding on ends of house. Tan crown and pilasters around front door.			
Evidence of Integrity Location/Materials	Original brick siding, possibly original vinyl siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Chimneys on either end of the house. Cement driveway leading to attached garage on left side of the house. Brick path and stairs with iron railing leading to front door. Bushes along front of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1211	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Chateausque			
Number of Stories	3	Width (bays)	4	
Foundation Material	Brick	Depth (rooms)	7	
Year Built	1831	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White dentils and modillions along second story and front porch. Two front gable dormers on each side of the roof of the tower. Cresting along top of mansard roof tower. White surround around windows and doors. Black shutters on first story windows at front of house with front porch. Spire roof on front of house with weathervane on point. Brick siding is painted white.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows. Addition on rear of house with what appears to be wood siding.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Wraparound front porch with hip roof. Chimney on rear of house, interior chimney towards rear of house. Metal chimney on mansard roof tower.			
Photo Views				
1 3/4 View	2 Side View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1009	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Religious Structure		1	
	Pre-school		1	
Current Use of Primary Building	Religious	Historic Use of Primary Building	Religious	
Style of Primary Bldg	Catholic Church			
Number of Stories	1	Width (bays)	9	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1971	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Main structure is the chapel with what appears to be offices and possibly living space in the back. Structure on the right side of the property is a catholic pre-school. Front gable overhang above entrancway to chapel. Front gable with windows and a cross on top on top of the chapel. Pre-school has side gable roof with extended shed roof dormer with windows. Vinyl siding on second story on rear of chapel.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Not compatible with surrounding single family homes			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	A large paved parking lot is around both structures. Metal bell tower with cross inbetween both strtructures.			
Photo Views				
1 3/4 View	2 Front View	3 3/4 View	4 Side View	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1407	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Prairie			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1929	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front porch with white columns and hip roof overhang. White surround around windows. Front gable in middle front of house. Modillions along second story.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New vinyl siding, roof, and windows. Addition on rear of house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement retaining wall along front of property. Cement stairs and path leading to cement front porch. Wood stairs leading to second story apartment with side entrance on the right side of the house. Cement driveway on left side of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1417	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1909	Wall Cladding Material	Asbestos siding	
Roof Shape	Front Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around doors and windows. Hip roof front porch with white modillions, pillars, and fence.			
Evidence of Integrity Location/Materials	Possibly original asbestos siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Fair			code F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Gravel driveway on left side of house. Cement path and stairs leading to front porch. Short cement retaining wall along front of property.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William	Street	1419	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-Colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	2015	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	White crown and pilasters around front door with keystone. Dark blue shutters on front windows. Shed roof overhand above front porch with white columns. Decorative circular window on each gable end.			
Evidence of Integrity Location/Materials	All original materials.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Gravel driveway on right side of house. Cement path and stairs leading from the sidewalk to the front porch. Small bushes along front of porch.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1423	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Prarie			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1922	Wall Cladding Material	Hardboard siding	
Roof Shape	Hip	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Grey shutters on windows. Hip roof overhang above front porch with decorative white pillars. Decorative star on first story left side of house. Decorative circular window on second story left side of house.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement retaining wall along front of property. White picket fence along front of property, white privacy fence around backyard. Gravel driveway laong left side of house. Cement stairs and path leading to front porch. Lamp post in front yard.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1501	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	1 1/2	Width (bays)	9	
Foundation Material	Brick	Depth (rooms)	3	
Year Built	2002	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Three front gable dormers on front middle of house. Roof overhang above front porch with white columns. Black shutters on front first story windows. Side lights and fanlight around front door. Fanlights above windows in center of building. Lintel with keystone above windows on either end of the building.			
Evidence of Integrity Location/Materials	Original siding, roof, and windows.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Curved cement driveway with bushes along either side. Driveway is shared with 1505 William. Bushes along front of house. White picket fence around backyard.			
Photo Views				
1 Front View	2 3/4 View	3	4	





Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	William Street		1505	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-Classical			
Number of Stories	1 1/2	Width (bays)	7	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	2005	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Three front gable dormers on front of house. Front gable on rear of house. Front gable on front right side of house. Roof extends over front porch with white columns. Black shutters on first story front windows. White surround around front door.			
Evidence of Integrity Location/Materials	All original materials			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Cement stairs and path leading to front porch. Curved driveway is shared with 1501 William. Bushes along front of property.			
Photo Views				
1 3/4 View	2 Side View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Stafford Avenue		1002	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	6	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1995	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on windows. Green front door. Two front gable dormers on front of house.			
Evidence of Integrity Location/Materials	All original materials.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Wood privacy fence around backyard. Cement driveway on right side of house. Cement stairs leading to brick stairs leading to front door. Brick stairs with white railing leading to side door on right side of the house. Bushes along front of house.			
Photo Views				
1 Side View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1004	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Stone	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Shed roof overhand with white supports above front stoop.			
Evidence of Integrity Location/Materials	Original stone siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick stairs leading to front door. Bushes along front of house. Lamp post in front yard. Gravel driveway on right side of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Stafford Avenue		1012	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1952	Wall Cladding Material	Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around windows and black shutters. White crown above front door.			
Evidence of Integrity Location/Materials	Original siding and appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	White privacy fence around backyard. Cement path leading to brick and cement steps and landing with iron railing in front of front door. Bushes on either side of landing. Chimney on right end of house.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1014	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Black shutters on windows on the front right side of house. Bay window to the right of the front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Bushes along front of house. Cement path leading to brick stairs and landing with iron railing in front of front door. Interior chimney. Chain link fence around backyard.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1100	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composite shingles	
Decorative Details/Unique Features	White shutters on front windows. Sidelight on either side of front door. Back door with iron railing and brick stairs by car port. Roof connects carport to main house			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	New roof, carport and roof connection to main house.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Shrubs along the front and side of house. Cement walkway leading up to brick stairs with iron railing leading to front door, paved driveway in back of house leading to carport. Interior chimney.			

Photo Views

1 Front View	2 3/4 View	3 Side View	4
--------------	------------	-------------	---



Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Stafford Avenue	1106	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Detached Garage	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Blg	Minimal Traditional		
Number of Stories	1	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1960	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Black shutters on front windows. White crown and pilasters around front door.		
Evidence of Integrity Location/Materials	Original door surround, original brick siding		
Additions/Alterations to Primary Building	Addition on the back of the house, with white vinyl and gable roof. New windows, new roof.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code C	
Other Comments / Salient Details	Cement driveway on left side of house leading to garage. Brick stairs and pathway leading up to front door with an iron railing, gardens along the sides of the house, Bushes along the front of the house. Lamppost on front lawn. Central chimney.		
Photo Views			
1 3/4 View	2 Front View	3	4
			

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Avenue		1114	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Asbestos shingle	
Decorative Details/Unique Features	Black shutters on windows on either side of house. Sun porch on right side of house. Front gable on left side addition. Tan crown and pilaster around front door.			
Evidence of Integrity Location/Materials	Original windows on either side of front door and original brick siding.			
Additions/Alterations to Primary Building	Addition on left side of house, new roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Brick pathway and stairs with iron railing leading to front door. Lamp post in front yard. Bushes along front and sides of house. Chimney on right end of house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Royston	Street	1410	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neocolonial			
Number of Stories	2	Width (bays)	7	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1965	Wall Cladding Material	Vinyl siding	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Door surround-neocolonial with holding fanlight, black shutters on windows, basement, chimney on left end of house			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New vinyl siding, new windows, addition on rear of house, large two story			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Brick retaining wall along front of property, brick steps and walkway with iron railing leading to front door, lamppost in front yard, trees and shrubs along front of property and house			



Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Royston	Street	1420	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gables on either side of the house. Black shutters on front windows. Roof overhang with square white columns above front porch.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	Converted attached garage on the left side of the house to a livable space, new windows, new roof			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement driveway on left side of house. Brick retaining wall along front of property. Cement and brick path leading to brick front porch. Bushes and gardens along front of the property and front of the house. Interior chimney on left side of the house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Royston	Street	1424	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Neo-colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1966	Wall Cladding Material	Brick & hardboard siding	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Large Porch with three support square columns with decorative arches in between. Green shutters on second story windows. Sidelights on either side of front door, attached garage on right side. Brick siding on first story, hardboard siding on second story.			
Evidence of Integrity Location/Materials	Original brick siding and windows			
Additions/Alterations to Primary Building	Sunroom addition on back of house, new roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick retaining wall along front of property, driveway leading up to garage on right side. Cement path and brick stairs leading to front porch. Bushes in front of porch, lamppost on front lawn. Chimney on right end of house. Side door on right side of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Royston	Street	1428	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Protruded entryway with front gable roof. White crown and pilasters around front door.			
Evidence of Integrity Location/Materials	Original brick siding, original windows			
Additions/Alterations to Primary Building	Porch on the right side of the house is an addition, new roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick path and stairs leading to front door. Privacy fence around backyard. Bushes along front and side of house. Sunroom on right side of the house. Chimney on left end of house.			
Photo Views				
1 Front View	2 Side View	3	4	







Name of Surveyors	Kimberly Packett	Survey Date	3/26/2016
ADDRESS	Street	Number	
	Buckner Street	1429	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Ranch		
Number of Stories	1	Width (bays)	7
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1963	Wall Cladding Material	Brick
Roof Shape	Cross Gable	Roof Material	Composition Shingle
Decorative Details/Unique Features	Front gable portico with white columns above small front porch. Front gable in center of building and on attached garage on right side of house. Sidelights on either side of front door.		
Evidence of Integrity Location/Materials	None		
Additions/Alterations to Primary Building	New siding, windows, and roof.		
Condition of Primary Building	Excellent	code E	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Non-Contributing	code N	
Other Comments / Salient Details	Basement entrance on left side of house with brick retaining walls on either side of entranceway. Backyard is elevated with a brick retaining wall. Privacy fence around backyard. Driveway on right side of house leading to attached double garage. Cement path and brick stairs leading to front door.		

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1425	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White crown and pilasters around front door. Green shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding. Appears to be original windows.			
Additions/Alterations to Primary Building	Addition on rear of house. New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Brick path and stairs with iron railing leading to front door. Chimneys on either end of house. Bushes along front of house. Cement driveway on left side of house.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Buckner	Street	1419	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Left side of the house has a front gable. Overhang over over front porch supported by column, white pilasters where overhang hits walls. White surround around front windows. Blue shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows on original part of house.			
Additions/Alterations to Primary Building	Addition on left side of house. New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Paved driveway on right side of house leading to attached garage. Bushes along front of house. Cement path and brick stairs leading to front door. Chimney on right end of the house. Lamp post in front yard.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Buckner Street	1415	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Shed	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Blg	Minimal Traditional		
Number of Stories	1	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	3
Year Built	1957	Wall Cladding Material	Brick
Roof Shape	Hip	Roof Material	Composition shingle
Decorative Details/Unique Features	White shutters on windows on right side of house, carport attached by roof to main house. Vinyl siding on sides of house.		
Evidence of Integrity Location/Materials	Original brick siding on front of house.		
Additions/Alterations to Primary Building	New windows, addition on back of house. New roof and new vinyl siding on sides of house.		
Condition of Primary Building	Fair	code	
		F	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code	
		C	
Other Comments / Salient Details	Wooden fence along part of backyard, shrubs along walkway between carport and house, brick steps and brick walkway leading up to front door, lamppost in front yard, paved driveway on left side of the house leading to car port.		
Photo Views			
1 Front View	2 3/4 View	3	4
			



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Buckner	Street	1411	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Brick porch with white railing and three supporting columns, front gable roof on overhang with vinyl siding. Black shutters on front windows. White surround around front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows, new roof.			
Condition of Primary Building	Fair			code F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Shrubs along the front of the house. Paved driveway on right side of house. Cement path from sidewalk leading to brick stairs and brick porch with white columns and railings. Brick stairs leading from the driveway on right side of porch. Chimney on right end of house.			

Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1430	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Frotn gable on right side of house that overhangs above small landing in front of front door with one white column. Door to the right of the garage door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Fair			code F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement driveway leading to attached garage on left side of house. Bushes along front of house. Cement path and stairs leading to front door. Interior chimney on left side of the house. Wood privacy fence around backyard.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1434	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2	Width (bays)	6	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	2007	Wall Cladding Material	Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Sidelights on either side of red front door. Front gable in middle of second story with palladian window. Stone façade on the front first story.			
Evidence of Integrity Location/Materials	All original materials.			
Additions/Alterations to Primary Building	None			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-contributing			code N
Other Comments / Salient Details	Paved driveway leading to attached garage on the left side of the house. Cement path leading from the driveway to the brick front porch. Bushes along front porch. Wood privacy fence around backyard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1436	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1966	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White shutters on front windows on either end of the house. Small brick front porch by front door. Bay window to the right of the front door with decorative white siding below.			
Evidence of Integrity Location/Materials	Original brick siding. Windows on either end of the front of the house appear to be original.			
Additions/Alterations to Primary Building	New window to the right of the front door, new roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Brick retaining wall along front of property. Brick stairs and path leading to front door. Bushes along front of house. Interior chimney on right side of the house. Paved driveway leading to attached garage on right side of the house. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1420	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1955	Wall Cladding Material	Stone	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with decorative circular window on right side of the house. Front gable dormer on left front side of the roof.			
Evidence of Integrity Location/Materials	Original stone siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Chimney on left end of the house. Cement driveway on left side of the house. Cement path and steps leading to small front porch.			
Photo Views				
1 Front View	2 3/4 View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Buckner	Street	1410	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1961	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with vinyl siding on left side of house. Black shutters on front windows. Attached carport on right side of house. Vinyl siding on either gable end.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Central chimney. Cement path leading from sidewalk to small cement front porch with overhang supported by iron support. Paved driveway leading to carport on right side of the house. Small bushes along front of the house.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Rappahannock Avenue		1005	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1968	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White shutters on front windows. Multi-colored brick siding.			
Evidence of Integrity Location/Materials	Original brick siding. Original windows.			
Additions/Alterations to Primary Building	New roof. Attached carport on left side of the house.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement path leading from sidewalk to brick stairs with iron railing leading to small cement front porch. Front porch has roof overhand supported by iron supports. Interior chimney. Paved driveway leading to attached carport on left side of the house. Bushes along front of house. Vinyl siding on left side of carport.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett	Survey Date	3/26/2016
ADDRESS	Street	Number	
	Rappahannock Avenue	1001	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Shed/Barn	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Ranch		
Number of Stories	1	Width (bays)	6
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1957	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Composition Shingle
Decorative Details/Unique Features	White shutters on front windows. Roof overhang above front porch with white columns and decorative archway between columns.		
Evidence of Integrity Location/Materials	Original brick siding.		
Additions/Alterations to Primary Building	New roof and windows.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code C	
Other Comments / Salient Details	Paved driveway leading to attached garage on left side of house. Cement path leading from driveway to brick front porch. Central chimney. Sunroom on right side of the house. Blue barn with a gambrel roof on the property.		

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/26/2016
ADDRESS	Street		Number	
	Rappahannock Avenue		1009	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brigh blue front door. Decorative brick mantel below windows on either side of front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and stairs with iron railing leading from the sidewalk to the front door. Overgrown bushes and trees make it difficult to see the rest of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1818	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Two dormers on front of roof with vinyl siding, central chimney, blue shutters on front windows, tan surround around front door, storm door, sun porch on right side			
Evidence of Integrity Location/Materials	Appears to be original windows on original part of house			
Additions/Alterations to Primary Building	Addition on back of house with vinyl siding and new windows			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Gravel driveway on the left side of the house, shrubs along the front and side of the house, cement steps with iron railing at front of property, cement path leading to brick stairs by front door, chain link fence around backyard			
Photo Views				
1 Front view	2 3/4 view	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Thornton	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1994	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingles	
Decorative Details/Unique Features	White shutters on windows, attached garage, front door on the left side of the house			
Evidence of Integrity Location/Materials	Appears to be all original materials			
Additions/Alterations to Primary Building	None noticeable, recent construction			
Condition of Primary Building	Good		code	
			G	
Observable Threats	Commerical land use nearby			
Compatibility with Adjacent Land Uses	Bad, not compatible with surrounding styles			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Driveway with bushes along it leading to attached garage, brick retaining wall along front of property, cement porch with white railing in front of front door, wood fence along street side of house			



Photo Views



1 Front View



2 3/4 View





Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Thornton	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Tudor			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1948	Wall Cladding Material	Wood siding	
Roof Shape	Side Gable	Roof Material	Cedar shake	
Decorative Details/Unique Features	Red wooden siding, two clipped gables on the front of the house			
Evidence of Integrity Location/Materials	Appears to be original siding			
Additions/Alterations to Primary Building	Addition on the back of the house			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Paved driveway on right side of the house, chimney on right side of house, cement stairs and steps leading up to cement porch and red wooden railing on stairs and porch. Many bushes and ivy on property, large tree on right side of house. Wooden fence around property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Thornton	Street	1218	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Asbestos shingles	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White horizontal shutters. Lanterns connected to house on either side of front door.			
Evidence of Integrity Location/Materials	Appears to be original siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Short wooden fence around backyard. Cement path and stairs leading to small porch with white metal railings. Trees and shrubs in front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				




Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Thornton	Street	1224	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1937	Wall Cladding Material	Vinyl siding	
Roof Shape	Gable-on-hip	Roof Material	Composition shingles	
Decorative Details/Unique Features	Blue shutters, white surround around front foer, central dormer on front of house.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, windows, door, and porch railing.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Central chimney, dirt driveway on left side of house leading to detatched garage, screened in porch on back of house, composited stairs leading to composite front porch with white railings and pillars.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Thornton	Street	1228	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1937	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entry porch with brick based columns. Green shutters on front of the house with diamond cutouts.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, windows, and roof. Entry porch was added to the building.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good.			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Wooden fence around property, paved driveway on left side of the house, cement pathway leading to composite board porch with black iron railings.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1811	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Colonial Revival			
Number of Stories	2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	1	
Year Built	2004	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark grey shutters on front windows, sidelights on either side of front door. Small covered landing in front of front door. Circular attic window below front gable.			
Evidence of Integrity Location/Materials	Most likely all orginial materials since house was built twelve years ago.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Poor, new construction.			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Wooden fence around backyard, cement driveway leading to attached garage. Bushes along front of house. Trees in front of property.			
Photo Views				
1 Front View	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Augustine Avenue	1819	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Detached Garage	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Blg	Cape Cod		
Number of Stories	1 1/2	Width (bays)	5
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1948	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Composition shingle
Decorative Details/Unique Features	White shutters on windows on front of house. Simple surround around front door with transom. Two small gables on front of the house. One gable on back of the house. Gables have asbestos siding.		
Evidence of Integrity Location/Materials	Original brick siding and appears to be original windows.		
Additions/Alterations to Primary Building	New roof, sun porch on left side of the house.		
Condition of Primary Building	Fair	code	
		F	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code	
		C	
Other Comments / Salient Details	Covered patio on back of the house, screened in porch on left side of the house. Cement path leading to front door with small landing with iron railing. Two driveways in backyard one leading to detached garage.		
Photo Views			
1 Front view	2 Side view	3 Backyard view	4
 			
			



Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Augustine Avenue	1815	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Blg	Cape Cod		
Number of Stories	1 1/2	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	3
Year Built	1946	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Asbestos shingle
Decorative Details/Unique Features	Front gable entry porch and two front dormers have hardboard siding. Black shutters on front windows. Front porch columns have brick bottoms.		
Evidence of Integrity Location/Materials	Original brick siding, original roof.		
Additions/Alterations to Primary Building	Entry porch addition on front of house, appears to be new windows.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code C	
Other Comments / Salient Details	Chimney on left side of building, cement pathway and steps leading to small covered front porch, porch has bare wood railing. Bushes along front of house, cement driveway on left side of the house.		
Photo Views			
1 Front view	2 3/4 view	3	4







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1237	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Vinyl siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on windows. Side gable roof on porch. Porch columns have brick bottoms. Circular attic vent on front dormer.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement retaining wall along front and left side of property. Basement access on left side of house. Cement stairs and path leading to porch. Stairs and small landing on back of house leading to back door.			
Photo Views				
1 Front view	2 Side view	3	4	







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1233	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1948	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around fron doors and windows. Two dormers on front of house. Red front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding and roof. Appears to be new windows. Addition on back of house.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Chainlink and wood fence around property. Cement path leading to stairs and small landing at front door. Interior chimney on right side of house. Dirt driveway on right side of house. Large bushes at front ends of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1953	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Sunroom on right side of house with flat roof with decorative railing along the edge. Blue shutter on front windows. Three dormers on front of house. Tan entablature around front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Addition with vinyl siding on back of house. Possibly original windows.			
Condition of Primary Building	Excellent			code
				E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	End chimney on right side of house. Cement path leading to front door with brick stairs with iron railing. Nicely manicured trees in front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	6	
Year Built	1939	Wall Cladding Material	Asbestos siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two small attics windows on front of house. Front porch with exposed roof beams. Attachment is a separate apartment.			
Evidence of Integrity Location/Materials	Original siding and possibly original windows.			
Additions/Alterations to Primary Building	Addition on back left of house. New roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Central chimney. Cement path leading to wood front porch with white railing and pillars with brick bottoms. Bushes in front of porch.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1221	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1962	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Bottom half of front façade is brick. Black shutters on front windows.			
Evidence of Integrity Location/Materials	Appears to be original siding.			
Additions/Alterations to Primary Building	New windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Gravel driveway on left side of the house. Cement path and stairs leading up to front door with landing with iron railings. Central chimney. Small bushes along front of the house. Has a basement with small small windows.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1215	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Painted white brick on protruding front façade of house with front gable.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Excellent	code		
		E		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Short brick wall along front of property. Cement path leading to front door with brick stairs and landing with iron railing. Bushes along front of house. Central chimney and chimney on back left of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1213	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Colonial Revival			
Number of Stories	2 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Asbestos siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front porch with hip roof. Two large tree to the right of the house. Two gables on front of the house.			
Evidence of Integrity Location/Materials	Original siding and possibly original windows.			
Additions/Alterations to Primary Building	Appears to be new roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Chimney on right end of house. Small bushes along front of house, large bushes along right side of house. Cement path leading to front door with covered porch with hip roof. Stairs have black iron railing while porch has white railing with white pillars.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1802	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detached Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1941	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Slate	
Decorative Details/Unique Features	White entablature around front door. Dark blue shutters on front windows. Two gables on front of house. One large dormer that runs the length of the house on the back with wood siding.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	Addition on the back of the house. New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Interior chimney on left side of house. Cement driveway leading to detached garage in backyard. Small bushes along front of house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1806	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	2016	Wall Cladding Material	Vinyl siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick front porch with black iron railings. Porch columns have brick bases and white tops. Porch has a hip metal roof. Decorative shingle on front gable on front of house. White surround around doors and windows.			
Evidence of Integrity Location/Materials	All original materials most likely since house was built this year.			
Additions/Alterations to Primary Building	None			
Condition of Primary Building	Excellent			code E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Bad, does not match surrounding styles			
Potential NR Eligibility	Non-contributing			code N
Other Comments / Salient Details	Pebble driveway on left side of house. Cement path from driveway to brick front proch. Side door with metal overhang on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1810	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1935	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Sky blue vinyl siding. Front gable entry porch above front door with white columns, white railing, and front gable. Cement stairs and landing leading at front door. White entablature around door, white surround around windows.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	Addition on rear of house. New windows, new siding, new roof.			
Condition of Primary Building	Good		code	G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Chimney on right end of house. Dirt driveway on right side of house. Bushes along front of house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1814	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1938	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entry porch with white columns over front door.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New roof, appears to be new windows.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Paved driveway on right side of house. Brick stairs and landing leading to front door. Bushes and small trees along front of house. Basketball hoop in front of shed.			

Photo Views

1 Front view

2 3/4 view

3

4



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1300	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split level			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1968	Wall Cladding Material	Brick	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Vinyl siding on left side of house. Diamond pane windows on front right side of house.			
Evidence of Integrity Location/Materials	Appears to be original brick siding and windows.			
Additions/Alterations to Primary Building	Vinyl siding appears new.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	Bushes and trees along front and left side of house. Cement driveway leading to attached carport on right side of house. Large end chimney on right side of house. Cement pathway and stairs leading to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	





Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1312	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Gable-on-hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on left side of house.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Addition on back. Appears to be new windows and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement driveway leading to detached garage on left side of property. Cement path leading to brick porch with brick columns, iron railings, and an overhang. Bushes along front of house. Chimney on right end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Sreet	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1969	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Small octagon window on front gable on right side of house. Front gable and side gables have wood siding. White shutters on window to the left of the front door. Window to the right of the front door has small square panes.			
Evidence of Integrity Location/Materials	Appears to be original windows and siding.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Bushes along front of house. Cement path and bricks stairs leading to front door with a small landing with a metal white decorative column. Chimney on right end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1320	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and possibly new windows.			
Additions/Alterations to Primary Building	Addition on rear of building, new roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement pathway leading to front door with brick steps and small cement porch with iron railing. Brick column holds up overhang above front door. End chimney on right side of house. Small bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1717	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Church		1	
Current Use of Primary Building	Religious	Historic Use of Primary Building	Religious	
Style of Primary Bldg	Baptist Church			
Number of Stories	1	Width (bays)	1	
Foundation Material	Concrete	Depth (rooms)	6	
Year Built	1970	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White spire on front of church.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows.			
Condition of Primary Building	Good		code	G
Observable Threats	Building is for sale.			
Compatibility with Adjacent Land Uses	Not good, surrounding by commercial and residential properties			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement path leading to brick stairs and landing with iron raililngs in front of white double doors with half circle transom. Large parking lot on the right of the church.			

Photo Views

1 Front view



2 Side view







3 Rear view




4 Side view



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1321	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1970	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on front windows. Small attic window on left side of house.			
Evidence of Integrity Location/Materials	Original brick siding. Appears to be original windows on the back and sides of house.			
Additions/Alterations to Primary Building	Right side of the building was changed from a garage to a livable space. Right side of building has new vinyl siding. New windows on front of house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Dirt driveway leading to right side of house. Chimneys on either end of the house. Shrubs and trees along edge of house. Rear door on right side of house. Cement path leading to front door with brick stairs, landing with iron railing.			
Photo Views				
1 Front view	2 3/4 rear view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1319	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1960	Wall Cladding Material	Vinyl siding	
Roof Shape	Salt box	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick bottom on the front façade. Carport with front gable roof attached to left side of house. Roof is extended over left side of house and front door. Skylight on front of roof.			
Evidence of Integrity Location/Materials	Brick is possibly original.			
Additions/Alterations to Primary Building	Deck attached to the back. New vinyl siding. New windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Paved driveway on left side of house leading to carport. Small bushes along front of house. Cement path leading from driveway to brick steps and cement landing in front of front door. Central chimney on the right side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1315	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White shutters on front windows. Fabric awning over front door. Vinyl siding on gables on either side of house and on roof extension on back of house.			
Evidence of Integrity Location/Materials	Appears to be original windows. Original brick siding.			
Additions/Alterations to Primary Building	Deck on the back. New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimney on the left end of the house. Cement path leading to front door with brick stairs and iron railing. Chain link fence around backyard. Small bushes and garden around front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1311	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Carport		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1950	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front door and windows. White surround around door and front windows.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	Screened in porch on back left side of house. New roof and vinyl siding.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Carport with metal columns. Paved driveway leading to carport on left side of the house. Central chimney on right side of house. Light above front door. Cement pathway to front door with brick stairs and iron railing			
Photo Views				
1 Front view	2 3/4 view	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1309	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1959	Wall Cladding Material	Wood siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on front windows. Diamond paned window on front of house. White surround around front door.			
Evidence of Integrity Location/Materials	Original windows and possibly original siding.			
Additions/Alterations to Primary Building	New roof, front right window appears new.			
Condition of Primary Building	Good		code G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code C	
Other Comments / Salient Details	Central chimney. Paved driveway on left side of house. Side door on left side of house. Cement path with cement step leading to front door.			

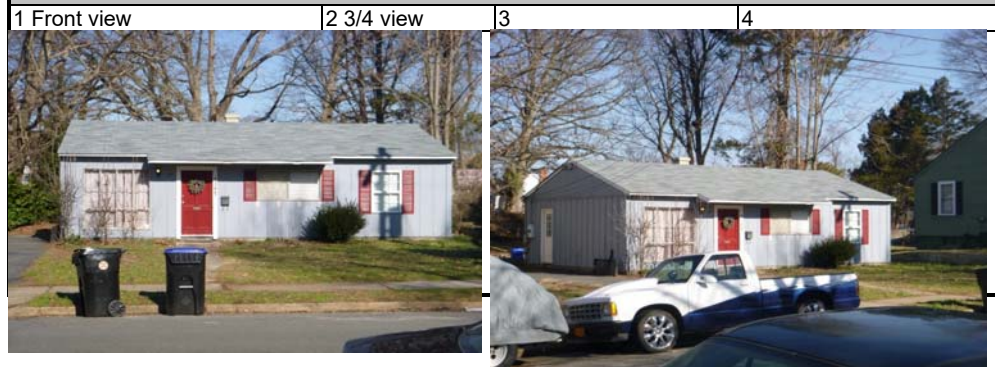
Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1305	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entry porch with white columns over front door. Black shutters on windows. White surround around front door.			
Evidence of Integrity Location/Materials	Possibly original windows.			
Additions/Alterations to Primary Building	New roof and appears to be new siding.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Additional exterior door on the right side of the house with cement stairs. Cement retaining wall along front of property. Cement path leading to front door with brick stairs and landing with white railing. Central chimney. Large bushes along front of house. Black lamppost on front lawn.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

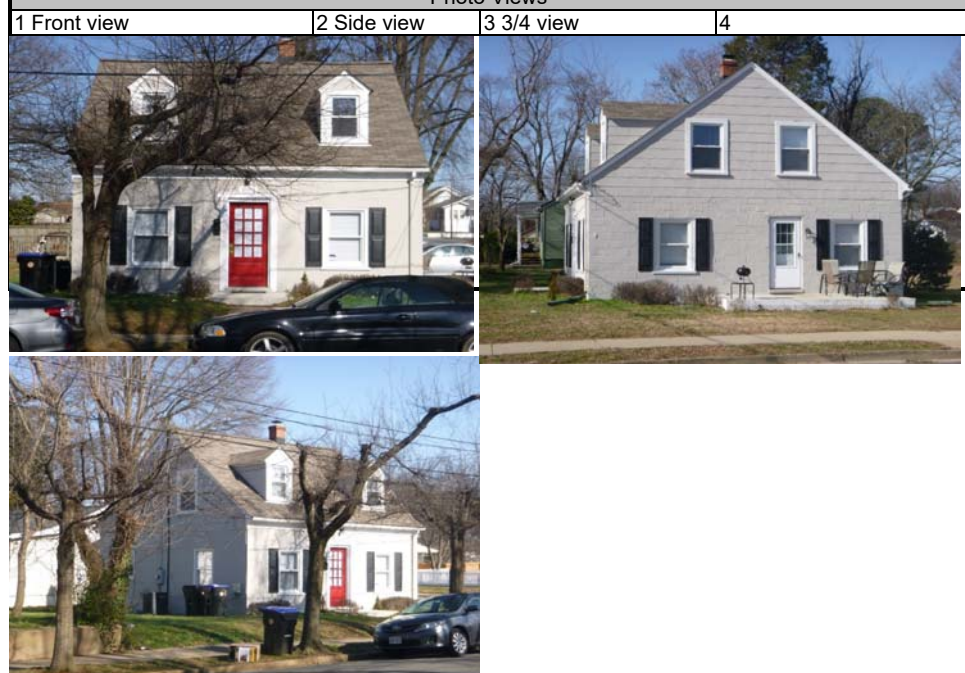

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1301	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1944	Wall Cladding Material	Cinderblock	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on windows on bottom story. White surround around front door and windows. Two dormers on front of house. Asbestos shingle on gable ends of house.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New roof, appears to be new windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Central chimney. Side door on right side of house with small porch. Cement landing at base of front door. Small bushes along front of house.			



Photo Views







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1706	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1959	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Entry porch with front gable and white columns. Front porch has a white wooden railing.			
Evidence of Integrity Location/Materials	Appears to be original windows on main part of house.			
Additions/Alterations to Primary Building	Attached garage on left turned into livable space. New roof and siding.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement path leading to wood front porch. Cement driveway on right side of property. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1708	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Cinderblock	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White vinyl siding on left side of house and front gable on right side of house. Red surround around windows and front door, matches the color of the front door. Large square 6 by 6 paned window to the right of the front door.			
Evidence of Integrity Location/Materials	Original windows and siding on right side of house.			
Additions/Alterations to Primary Building	Addition on left side of house.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	This house is set far back from the street, almost behind two other houses. Wood picket fence along property line. Unusable dirt driveway on left side of the house. Cement path leading to wood porch with wood railing along front left side of the house.			
Photo Views				
1 Front view	2	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1209	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family Home		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Maroon shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Central chimney. Cement path leading to front door with brick stairs and iron railings. Bushes along front of house. Brick wall along right of property that belongs to adjacent house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1712	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1953	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Bay window on front left side of house. Two dormers on roof on the back side of the house. Lamp attached to the wall on either side of the front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Patio on the back of the property. New windows and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimneys on either end of the house. Cement path leading to brick landing with cement steps with iron railings. Wood privacy fence around backyard. Paved driveway on right side of the house. Bushes along front of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1213	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1935	Wall Cladding Material	Asbestos siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable roof over front porch along right side of house. Decorative attic vent on front of house. White surround around door and windows. Lanterns attached to the wall on either side of the front door.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New windows and new roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement path leading to wood porch with white railings and columns. Large bushes along front and side of porch.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1217	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detached Garage		2	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1932	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around door and windows. Dark green shutters on windows. Dormer with hip roof on front of house.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and new windows.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Gravel driveway on the right side of the house leading to detached garage. White plastic fence along the right side of the property. Central chimney. Cement path leading to brick porch that spans the length of the front of the house with four white columns. Small bushes along front of the house, large bushes on the left side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1926	Wall Cladding Material	Aluminum siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dormer with hip roof on front of building. Tan surround around windows.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New roof and new windows. Addition on the back of the house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Dirt path leading to cement stairs and wood porch with white railings and white columns. Two large trees on either side of house. Central chimney on back right of the house. Roof extends over wood porch with white railings and white columns.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1935	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Grey surround around windows and door. Two dormers on front of house. Front gable entry porch.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition and deck on the rear of the house. New roof, siding, and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Dirt driveway on the right side of the house leading to shed. Dirt path leading to wood stairs and landing with white columns and railings at foot of front door. Bushes along front of house. Chain link fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1231	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family Houst		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Decorative wood arch over cement pathway. White metal decorative column on front porch holding up roof overhang. Black shutters on windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Central chimney on right side of house. Cement driveway leading to the attached garage on right side of the house. White picket fence around the backyard. Cement stairs and path with white railing leading to brich porch at foot of front door. Bushes along edge of house.			


Photo Views

1 Front view	2 Side view	3 3/4 view	4
--------------	-------------	------------	---





Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1711	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1988	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Light blue shutters on windows that match front door. White surround around windows. White pedimented surround around front door. Yellow siding.			
Evidence of Integrity Location/Materials	Appears to be all original materials.			
Additions/Alterations to Primary Building	None			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Different style than surrounding houses.			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Chimney on right end of house. Cement driveway on left side of house. Cement path leading to brick stairs with white railing leading to front door. Bushes along front of house. Wood privacy fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1715	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	?	
Foundation Material	Brick	Depth (rooms)	?	
Year Built	1961	Wall Cladding Material	Aluminum siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Shrubs and trees cover the front of the property. Multiple front gables.			
Evidence of Integrity Location/Materials	Appears to be original siding.			
Additions/Alterations to Primary Building	Hard to tell due to trees and shrubs.			
Condition of Primary Building	Poor		code	P
Observable Threats	Trees and plants are taking over the property and attaching to the house.			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Chain link fence around entire property. Cement path leading to brick stairs and cement porch at front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1719	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Stone	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of house. Octagon shaped window on front gable. One dormer with vinyl siding on front of roof. Solar panels on front of roof.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New roof, stone siding, and windows. Screened I porch on back of property.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement path leading to front door with stone steps. Chimney on left end of house. Detatched two car garage in backyard with cement driveway. Cement path leading to back door. Bushes along front and side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1228	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1936	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two dormers on front of roof. White surround around windows with tan shutters. Front door has white surround with pilasters.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Bushes along front of house. Central chimney. Cement path leading to front door with brick stairs and iron railing. Screened in porch on left side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	








Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1224	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on middle, front of the house. Blue shutters on windows. Left side of front porch has white crosshatching wall. Black lamppost on front lawn.			
Evidence of Integrity Location/Materials	Original brick siding and possible original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Central chimney. Paved driveway on left side of the house. Bushes along front of house. Short brick columns on either side of the beginning of the cement path leading to front door. Path lead to front door with brick steps and cement landing.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1932	Wall Cladding Material	Vinyl siding	
Roof Shape	Gable-on-hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around door and . Blue shutters on windows.			
Evidence of Integrity Location/Materials	Possible original brick front façade.			
Additions/Alterations to Primary Building	Addition on the back of the house. New windows, roof, and vinyl siding.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement path leading to front door with brick stairs and porch that spans the length of the front of the house. Porch has white railing and columns. Cement driveway on right side of house leads to detached garage.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Seacobeck	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	7	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1979	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on windows and white surround around front door.			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement driveway on left side of house leads to two car garage. Brick front porch with white railing and columns. Small bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	






Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1718	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Neo-colonial			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1935	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Slate	
Decorative Details/Unique Features	Black shutters on majority of the windows. Three dormers on front of house. Front gable entry porch with white columns. White surround around front door with transom. Two extended dormers on back roof of house. Addition in back has a front gable roof. Side door with white surround and white entablature.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Addition on back of house. New roof and windows.			
Condition of Primary Building	Excellent			code E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	One chimney on the end of the left side of the house and one chimney on the end of the back addition. Two car garage in backyard with cement driveway. Short iron fence around backyard. Small bushes along foot of house. Black lamppost in frontyard. Cement path and stairs leading to both the front door and the side door. Brick path leading to back door.			
Photo Views				
1 Front view	2 Side view	3 Rear view	4	
				
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1714	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1953	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door with entablature. Two dormers on front side of roof. Dark blue shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof, new vinyl siding on dormers.			
Condition of Primary Building	Good		code	G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Paved driveway on left side of house. Small bushes along front of house. Cement path and brick and cement stairs leading to front door with iron railing. Chimney on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1706	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on left side of house that hangs over small front porch. Front gable has white vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding and appears to be original windows.			
Additions/Alterations to Primary Building	Appears to be new vinyl siding on front gable.			
Condition of Primary Building	Good			code G
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Wood fence around backyard. Bushes along front of house. Skinny paved driveway on left side of house for motorcycle. Paved driveway on right side of house for car. Central chimney. Cement path leading to front door with brick stairs and landing with iron railing. White columns holding up overhang above front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1309	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of house. Dormer on front left of roof. White surround around front door and windows. White shutters on front window.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	Addition on the left side of the house. New roof and vinyl siding.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Bushes along front of house. Cement retaining wall along front of property. Cement stairs and path leading to front door with cement landing and iron railings. Iron lamppost in front yard. Central chimney on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1313	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1946	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on bottom front windows. Two gables on front of roof. White surround around front door.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New roof and vinyl siding.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement retaining wall along front of property. Cement stairs and path leading to front door with cement landing with brick steps and iron railings. Short wood picket fence in backyard and right of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1319	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around door with entablature. White surround around windows. Red shutters on front windows.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New roof and vinyl siding.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Central chimney. Screened in porch on right side. Bushes along base of house. Chainlink fence around backyard. Cement steps with wood railing leading to cement path leading to brick/cement steps with iron railings that leads to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1321	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1942	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Diamond paned windows. Two dormers on front of house. Uneven front gable in center of house with front door.			
Evidence of Integrity Location/Materials	Original windows. Possible original siding.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement retaining wall along front of property. Cement stairs and path with iron railing leading to front door. Bushes along cement path. Chimney on left side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Stafford Avenue	1605	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Minimal Traditional		
Number of Stories	1 1/2	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	3
Year Built	1951	Wall Cladding Material	Asbestos siding
Roof Shape	Side gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Front gable on right side of house. Red shutters on bottom front windows that match front door. White surround around front door. White decorative vent on front gable. Overhang over front door with white column.		
Evidence of Integrity Location/Materials	Original siding.		
Additions/Alterations to Primary Building	New roof and appears to be new windows.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	Or C	
Other Comments / Salient Details	Chimney on left end of house. Cinderblock retaining wall along front of property. Gold lamppost on front lawn. Bushes along front of house. Brick steps and cement path with iron railing leading to front door with small landing with brick steps and iron railing.		
Photo Views			
1 Front view	2 3/4 view	3	4
			


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Avenue		1609	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)		
Year Built	1949	Wall Cladding Material	Cinderblock	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Windows have a grey sill. Addition on the back of the house has vinyl siding and front gable.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	New roof. Addition on the back of the house.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement retaining wall along front of property with cement steps leading to stone pathway. Cement steps with iron railing leading to front door. Chimney on right side of the house. Paved double driveway on right side of house. Side door with cement steps and iron railing on right side of house. Small bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Avenue		1615	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1956	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Gable with vinyl siding on right side of building. Simple white surround around purple front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Bushes and garden on front right side of house. Brick and cement retaining wall along right side of property. Cement driveway and stairs with iron railing leading to front door. Two decorative iron columns holding up overhang above front door. Central chimney on right side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Stafford Avenue	1617	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Ranch		
Number of Stories	1	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	5
Year Built	1949	Wall Cladding Material	Hardboard siding
Roof Shape	Hip	Roof Material	Composition shingle
Decorative Details/Unique Features	Brick front façade. Simple white surround around front door and windows.		
Evidence of Integrity Location/Materials	Original windows.		
Additions/Alterations to Primary Building	New hardboard siding and brick façade doesn't look original. New roof.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code C	
Other Comments / Salient Details	Small bushes along front of house. Brick path leading to front door with brick stairs and iron railings Chimney on the left end of the house. Wooden fence around backyard. Cement patio in backyard with roof overhang with white columns. Back door leading to porch.		

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1320	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Shed roof overhang above front door. Side door has awning. Front gable with hardboard siding on right side of house. Decrative circle window on front gable.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Paved driveway on left side of the house. Cement path leading from driveway to front door. Cement and brick steps and landing leading to front door with iron railing. Cement path leading from sidewalk to side door. Chimney on the left side of the house. Woof privacy fence around backyard. Bushes along front of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1958	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick façade on the bottom front of the building. Blue shutter on front windows. White surround around front door with entablature			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New windows, vinyl siding, and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Central chimney on right side of the house. Cement path leading to front door. Small bushes along front of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1306	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on front windows that match front door. Curved white pediment above front door with pilasters on either sides. Transom above front door.			
Evidence of Integrity Location/Materials	Original siding and appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement and gravel driveway on left side of the house. Brick retaining wall along front of property and driveway. Chimney on left end of house. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett	Survey Date	2/21/2016
ADDRESS	Street	Number	
	Augustine Avenue	1620	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Craftsman		
Number of Stories	1 1/2	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	3
Year Built	1951	Wall Cladding Material	Brick
Roof Shape	Cross gable	Roof Material	Compositon shingle
Decorative Details/Unique Features	White surround around doors and windows. Entry porch with front gable and white columns and railings above front door that stretches to the right edge of the house. Entry porch with front gable over side door.		
Evidence of Integrity Location/Materials	Original brick siding.		
Additions/Alterations to Primary Building	New roof and windows.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Non-Contributing	code N	
Other Comments / Salient Details	Chimney on right end of house. Cement retaining wall along right side of the house. Cement stairs and path leading to side door with brick porch and front gable overhang with vinyl siding and white columns. Cement stairs and path with iron railings leading to front porch with wood railing and front gable overhang with vinyl siding.		



Photo Views







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1614	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1939	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark green shutters on front windows. White surround around front door with entablature. Green roof.			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Chimney on right end of the house. Bushes along front of house. Cement stairs and path with iron railings leading to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1610	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1944	Wall Cladding Material	Hardboard siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows. Dormer with hip roof on front of house. Porch with wood railing and half brick, half wood columns.			
Evidence of Integrity Location/Materials	Original windows.			
Additions/Alterations to Primary Building	New siding and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Paved driveway on right side of the house. Cement retaining wall along front of property. Black lamppost in front lawn. Cement stairs and path with iron railing leading to front porch.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1600	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on front of roof. Extended three window dormer on back of roof. White surround around front door. Dark blue shutters on front bottom windows.			
Evidence of Integrity Location/Materials	Appears to be original siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement driveway in backyard. Bushes along base of house. Cement path leading to brick stairs with iron railing that leads to front door. Central chimney.			
Photo Views				
Front view	2	Rear view	3	4
 				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1209	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1939	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front windows that match front door. White pilasters and triangular pediment.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Small addition on right side of the house. New roof. Appears to be new windows.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Addition on right side of house has vinyl siding and exterior door. Brick stairs and iron railing lead to door on addition. Chimney on right end of house. Short brick retaining wall along front of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1213	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Cinderblock	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Siding has been painted turquoise. White shutters on front windows and white surround around front door. Many bushes, plants and decorative lawn ornaments in front yard.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	Addition on the back of the property, new roof.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Interior chimney on back of house. Short cinderblock wall around back yard and front right of property. Paved driveway on front left side of property. Cement path leading from driveway to front door. Side door on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1217	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1	Width (bays)	2	
Foundation Material	Concrete	Depth (rooms)	5	
Year Built	1944	Wall Cladding Material	Vinyl siding	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan surround around front door. Green storm door and front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on the back of the house. New roof, siding, and windows. Overhang addition on front of house.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Side gable has an extended roof to cover front porch. Wood ramp on left side of house leads to front porch. Cement driveway on right side of house. White privacy fence along right and back side of property. Cement path and wood stairs leading to wood front porch with tan and white railings and columns. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1221	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1938	Wall Cladding Material	Hardboard siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Decorative dentils on eave of hip roof above front porch. White surround around front door and windows. Green shutters on front second story window. Extended shed roof two window dormer on right side of roof.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Appears to be new roof, windows, and siding.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Small bushes along foot of front porch. Cement driveway along right side of house. Cement path and steps leading to front porch with brick and wood columns.			
Photo Views				
1 3/4 view	2 Front view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed/Guest House	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Tudor			
Number of Stories	2 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1934	Wall Cladding Material	Vinyl siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Middle of first story protrudes and has a front gable and the front door. Tan surround around front door and windows. Front windows have pink shutters. Extended dormer with three windows along front of roof.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New roof and vinyl siding.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Brick stairs and path with tan wood railings leading to front door. Chimney in on front of house. Paved driveway on right side of house leading to a possible guest house. Guest house has two front gable dormers on front of roof. Stone retaining wall along left side of driveway. Bushes and ivy on front lawn, iron lamppost on front lawn.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street	Number		
	Parcel	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1933	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New vinyl siding, roof, and windows.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Wood privacy fence around backyard. Cement stairs and path leading to cement and wood front porch. Bushes along front left of house. Chimney on back left of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1601	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1951	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front windows that match front door. Entablature around front door with sidelights. White surround around windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Appears to be new windows and roof. Addition on left side of the house made of stone with a flat roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimney on right end of the house. Wood privacy fence around backyard. Brick stairs and path with iron railing leading to front door. Ivy incline along sides of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1609	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1951	Wall Cladding Material	Brick	
Roof Shape	Hip on gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of house with vinyl siding and circular window. Screened in front porch.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Wood privacy fence around backyard. Large bushes along front of house. Cement path and stairs with iron railing leading to screened in front porch. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1236	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1934	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green surround around front door and windows. Front porch wraps around on right side of the house. Porch has white railings and brick bottom columns.			
Evidence of Integrity Location/Materials	Appears to be original siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Wood privacy fence around backyard. Stone surrounding gardens around base of house. Cement path and stairs leading to front porch from the front and side of property. Chimney in back left side of the house.			
Photo Views				
1 Front view	2 Side view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1232	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1941	Wall Cladding Material	Vinyl siding	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with a side gable on the front. Large front porch with shed roof overhang supported by brick and wood columns.			
Evidence of Integrity Location/Materials	Original windows.			
Additions/Alterations to Primary Building	New siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Wood picket fence around front yard. Wood privacy fence around backyard. Cement driveway along right side of house leading to detached garage in backyard. Cement path leading to wood front porch. Chimney on back right of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1228a	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Bungalow			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Asbestos siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red surround around front door and front windows. Dormer with hip roof and two windows on front of roof.			
Evidence of Integrity Location/Materials	Original siding and windows. Could possibly be original roof, it's in poor condition.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Poor		code	P
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Wood deck on back of house. Cement path leading to wooden front porch with overhang and wood railings and columns.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1228b	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Asbestos siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows. Shed roof overhang supported by two white columns above front door.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	Appears to be new roof and windows.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	House in set in backyard of another property. Gravel driveway leads to front of house.			
Photo Views				
1 Front view	2	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1224	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Split Level			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1973	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick front façade. Broken pediment and white columns around front door. Red shutters on front windows that match front door.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	Appears to be a new roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement path and stairs leading to front door. Paved driveway on left side of house leading to detached garage. Chimney on right end of the house. Small bushes in front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1220	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1919	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Decorative cinderblocks along front of property. White surround around front door and windows. Hip roof overhang with four white columns above front porch.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New roof, siding, and windows.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Dirt driveway on left side of the house. Wood chip garden in front yard with plants and bushes. Cement stairs and path leading to front door with cement front porch. Cement stairs leading from driveway to front porch.			
Photo Views				
1 Front view	2 3/4 view	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Dutch Colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1974	Wall Cladding Material	Aluminum siding	
Roof Shape	Gambrel	Roof Material	Composition shingle	
Decorative Details/Unique Features	Modillions below front eave. Blue shutters on bottom front windows. White surround around front door and first story windows. Three front gable dormers on front of roof.			
Evidence of Integrity Location/Materials	Original aluminum siding and windows.			
Additions/Alterations to Primary Building	Appears to be a new roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement and brick driveway on left side of property. Cement path and stairs with white railings leading to front door. End chimney on right side of house. Wood privacy fence around backyard. Small bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entry porch and two white columns above front door. White surround around front door and windows.			
Evidence of Integrity Location/Materials	Possibly original siding hard to tell, freshly painted.			
Additions/Alterations to Primary Building	Addition on rear of house, new roof and windows.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimney on right end of house. Brick driveway on left side of the house. Side door on left side of house. Wood chip garden with plants, bushes, and trees takes up the whole front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1208	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1934	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entry porch and decorative eagle above front door with two white columns. Blue shutters on front windows. White crosshead above first story front window. White surround around front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on the back. New roof, vinyl siding, and windows.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Rear addition has shed roof. Gravel driveway on right side of house leading to shed in backyard. Central chimney in the back of the house. Side door on left side of rear addition. Cement path leading to front foor with cement landing. Bushes along front of house. Short white fence around backyard. Short brick wall along left side of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1618a,b	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Broke triangular and segmental pediments around front door. Blue shutters on front windows and white surround around them as well. Brick steps and landing with iron railing leading to front door. White panels under first story windows.			
Evidence of Integrity Location/Materials	Original brick siding. Possibly original windows on original section of building.			
Additions/Alterations to Primary Building	Addition on the back. New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Bushes along front of house. Wooden stairs on right side of the house lead to the entrance to the second story, which is a separate apartment.			
Photo Views				
1 Front view	2 Side view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1616	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Dutch Colonial			
Number of Stories	3	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1930	Wall Cladding Material	Asbestos siding	
Roof Shape	Gambrel	Roof Material	Composition shingle	
Decorative Details/Unique Features	Rear addition has front gable roof. Extended dormer on front of roof with three windows. Front gable entry porch and two white columns above front door. Front foor has a window and sidelights.			
Evidence of Integrity Location/Materials	Possibly original siding and windows.			
Additions/Alterations to Primary Building	Addition on back of building. New roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Chimney on interior front right side of the house. Cement walkway leading to front foor with cement landing. Bushes along front of house and right side of property. Brick and cement driveway on front right side of property. Low cement retaining wall around grass and garden areas in front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College Avenue		1614	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Commerical Structure		1	
Current Use of Primary Building	Religious	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neoclassical			
Number of Stories	2	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1929	Wall Cladding Material	Brick	
Roof Shape	Flat	Roof Material	Poured asphalt roof	
Decorative Details/Unique Features	Flat roof entry porch with white columns, wall under entry roof is painted white. White surround around double front doors and windows. Front doors have a semi-circular transom. White keystone above front windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Roof, siding and windows all appear new.			
Condition of Primary Building	Excellent		code	E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Surrounding buildings are mainly residential, besides UMW			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Paved parking lot on front left side of property. Cement stairs with iron railing leading from parking lot of cement porch. Cement path leading from sidewalk to cement porch.			


Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College	Avenue	1604	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on front window. White surround around front door with transom. Two front gable dormers on original part of building, one clipped roof dormer on the addition on the left side of the house. Saltbox roof on addition on left side of house.			
Evidence of Integrity Location/Materials	Appears to be original windows on original part of structure.			
Additions/Alterations to Primary Building	Additions on left and right of main structure			
Condition of Primary Building	Good		code	
			G	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway behind the house. Bushes along front and side of house. Cement path leading from driveway to front door with brick stairs and iron railing. Wood privacy fence around backyard.			
Photo Views				
1 Front view	2 Side view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1308	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1959	Wall Cladding Material	Brick & vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition Shingles	
Decorative Details/Unique Features	Dark blue shutters on front windows. Brick gardening box on front left side of house.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Screened in back porch, appears to be new windows and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimneys on either end of the house. Cement path leading to front door with bricks stairs and iron railing. Bushes along front of house.			

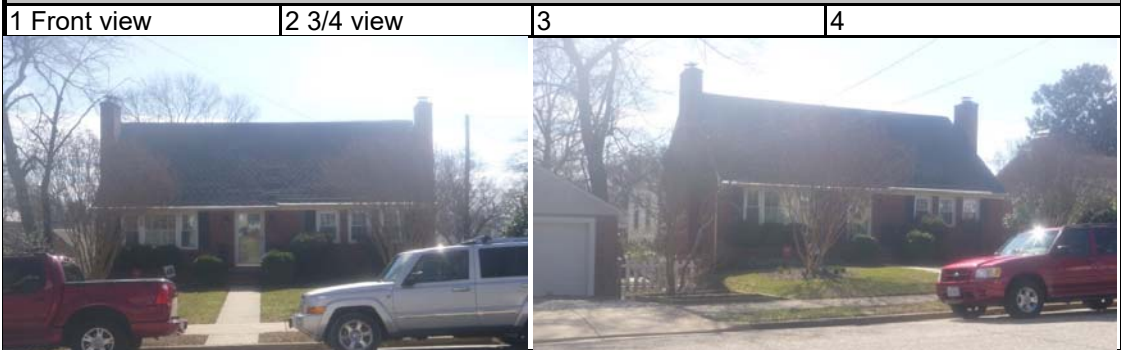Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1312	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingles	
Decorative Details/Unique Features	Blue shutters that match front door. White surround around front door. Front gable on the right side of the house with white siding. Low pitch overhang above front porch.			
Evidence of Integrity Location/Materials	Appears to be original windows, original brick siding.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Concrete walkway leading to brick front porch with white railing and columns. Small bushes along front of house. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	College Avenue		1702	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Mixed Style			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1953	Wall Cladding Material	Brick	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Hip roof entry porch with white columns and a hip roof over front door. White surround around front door and windows. Overhang over back porch with white columns.			
Evidence of Integrity Location/Materials	Original brick siding and appears to be original windows.			
Additions/Alterations to Primary Building	Addition on back of house. New roof.			
Condition of Primary Building	Excellent		code	E
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Chimney on the left end of the house. Paved driveway in backyard. Decorative brick wall around property. Decorative pineapple statues on wall in front. Brick archways in brick wall to the right and side of the house. Brick stairs and path leading to front foor with small brick porch. Bushes and garden around base of house.			

Photo Views







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1312	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-Colonial			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1948	Wall Cladding Material	Brick	
Roof Shape	Hip-on-gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Three dormers on front of roof. Front gable on right side of house with decorative circular window. White vinyl siding on sides of house.			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick and cement retaining wall along front of property. Cement stairs and path leading to front porch. Chimney on left end of house. Brick front porch with white columns and railing. Black lamppost on front lawn.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1323	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Mixed Style			
Number of Stories	1 1/2	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1950	Wall Cladding Material	Asbestos siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Grey shutters on windows and front door. White surround around front door and windows with entablature.			
Evidence of Integrity Location/Materials	Original siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	White picket fence around backyard. Brick steps with iron railing leading to front door. Central chimney. Shed in the backyard. Cement retaining wall along front of property with cement steps and iron railing. Bushes along front of house.			



Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Rowe	Street	1210	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Vernacular			
Number of Stories	1	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1934	Wall Cladding Material	Vinyl siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows. Front gable entry porch with two white columns above front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, windows, and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	Brick path leading to front door with small brick porch. Gravel driveway on the left side of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Parcel	Street	1320	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Hipped	Roof Material	Composition shingles	
Decorative Details/Unique Features	White shutters on front windows.			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	Addition to the back of the house. New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on left side of house leading to attached carport. White decorative metal wall supporting carport. Cement path leading from sidewalk to driveway. Cement path leading from driveway to front door with white metal railing. Interior chimney on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
 				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1518	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detached Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	5	
Foundation Material	Cinder Block	Depth (rooms)	3	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Gable dormers with aluminum siding on front of roof, pilasters on either side of the front door and crosshead above door, dark blue shutters on front windows. Extended dormer with two windows on back side of roof.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Rear addition, side porch addition on the right. New windows and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Garage in the back with gravel driveway. White fence around backyard. Stairs in the back leading to basement. Cement and brick path and stairs with iron railing leading to front door. Cement path and bricks stairs leading to side porch with overhang and side door. Porch has white railings and columns. Chimney on right end of house.			
Photo Views				
1 Front view	2 Side view	3 Backyard view	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1508	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1951	Wall Cladding Material	Wood siding	
Roof Shape	Hipped roof	Roof Material	Composition shingles	
Decorative Details/Unique Features	Decorative surround on door with pilasters and crosshead. Dark blue shutters on second story windows. White surround around windows.			
Evidence of Integrity Location/Materials	Original windows.			
Additions/Alterations to Primary Building	Addition on back of house. New roof and siding.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on left side of house. Cement path leading to front door with brick stairs and iron railings. Chimney on right side. Wooden fence around property. Two large trees in front lawn. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1506	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1957	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Brick siding on first floor, vinyl siding on second story. Green shutters on front windows. Decorative keystone above front door. Second story has slight overhang.			
Evidence of Integrity Location/Materials	Possibly original brick siding on first floor.			
Additions/Alterations to Primary Building	New vinyl siding, windows, and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Paved driveway on right side of house, brick retaining wall along left side of property. Concrete and brick walkway leading to front door with iron railing and lamp. Chimney on right end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1504	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Small shed/Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition Shingles	
Decorative Details/Unique Features	An arch pediment over the door/shutters. Sunken in entry way with cream paneling on either side of front door and pilasters. Decorative brick around the windows. Dark blue shutters on front windows.			
Evidence of Integrity Location/Materials	Appears to be original windows and door surround details. Original brick siding.			
Additions/Alterations to Primary Building	A porch and addition on the back. Addition has vinyl siding. Porch is made of brick and iron railings. New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	A brick set of stairs and path to the front porch, with iron railings and iron lamp post. Driveway on the left side of the property leading to the shed/garage which is made of matching brick. Chain link gate on driveway. Brick fence around some of the property. Chimney on right end of house. Bushes along walkway and front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1500	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Small Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Dutch Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1940	Wall Cladding Material	Stone	
Roof Shape	Gambrel	Roof Material	Slate	
Decorative Details/Unique Features	Front gable entrance extension out from main body of house. Green shutters on second story front windows and bottom left front window. Side entrance with stone porch and iron railing. Copper gutters. Vinyl siding on extended dormer.			
Evidence of Integrity Location/Materials	Appears to be original windows and original stone walls. Copper gutters			
Additions/Alterations to Primary Building	Addition hall connecting main house to secondary building has entrance and small porch with wooden stairs leading to a concrete path and stairs. Addition and hall made of aluminum siding and has glass brick windows and asphalt roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Slate and concrete steps and walkway up to the house and front porch (of the same material). Small wooden retaining wall with plants in the front yard. Wooden privacy fence around the house. Concrete retaining wall around the lawn on the side of the house.			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4	
 				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1309	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1965	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Two dormer windows on the front of the house. Light blue shutters on front door and front windows. White surround around windows.			
Evidence of Integrity Location/Materials	Appears to be original windows, brick siding and porch.			
Additions/Alterations to Primary Building	Enclosed porch on the back of the house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Driveway on left side, wooden fence, and lattice shed. Poured concrete driveway with brick retaining wall all around the front lawn of the house. Brick steps up to lawn then slate path to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1315	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detached Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1952	Wall Cladding Material	Stone	
Roof Shape	Hip	Roof Material	Composition shingles	
Decorative Details/Unique Features	Red shutters on windows match red surround around front door. Hip roof has two tiny front gables at peaks of roof.			
Evidence of Integrity Location/Materials	Appears to be original stone siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement driveway on right side of the house leading to detached garage. Cement path and stairs leading to front door from driveway. Iron railing on stairs. Central stone chimney. Cement retaining wall along right side of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1317	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1957	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on front windows and front door. White surround around front door and windows. Roof extended over front porch.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New windows, roof, and vinyl siding.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Driveway of gravel and grass on left side of the property. Brick walkway to brick steps and poured concrete porch with iron railings and white columns.			






Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1321	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1955	Wall Cladding Material	Stucco	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gable entryway with white columns, dark blue shutters on front windows and front door. Gables have vinyl siding. Two front gable dormers on front of roof.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	Stucco covers the original siding. New roof. One room addition on the back left of the house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Paved driveway on left side of property. A lot of landscaping from porch to sidewalk with flowers, shrubs, and a small tree. Cement path and stairs from driveway to front porch with iron railing. Wood retaining wall along right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Ave		1503	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1951	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gable dormers with vinyl siding on front of roof. Extended dormer on back of roof. Hip roof on screened in porch on right side of house and hip roof on back addition. White surround around front door and windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Screened in porch on the right side, addition on the back. New windows and roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Concrete driveway leading to detached garage in backyard. Cement path leading to front door. White wood stairs and railing leading to side screened in porch. Bushes along front and side of house.			


Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Ave		1505	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal traditional			
Number of Stories	1.5	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1948	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Window boxes on the left side of house. Section of wall dividing roof on front right side.			
Evidence of Integrity Location/Materials	Appears to be original windows on original part of building.			
Additions/Alterations to Primary Building	Addition on the back of the house. New siding and roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Wood privacy fence in the backyard, brick walkway to the front door. Overhang above entrance way with white column. Interior chimney on right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Ave		1511	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Dark blue shutters on front and side windows. White vinyl siding around screened in porch and front gable above front door.			
Evidence of Integrity Location/Materials	Appears to be original windows, replacement roof			
Additions/Alterations to Primary Building	Attached garage to the right, connected by enclosed walkway; Addition on the back with hip roof, part of addition is a screened in porch.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick walkway leading to the front door with overhand with white column, backyard surrounded by privacy fence, curved asphalt driveway in backyard leads to attached garage. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Brick	Depth (rooms)	3	
Year Built	1936	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition gable	
Decorative Details/Unique Features	Front gable entry way with white columns. Green shutters on front door and front and side windows. White surround around front door and windows.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New siding and roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Bushes along path and foot of house. Cement path leading to front door with bricks steps and small brick porch with iron railing. Iron lamppost in front yard. Chimney on right end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1217	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	American Foursquare			
Number of Stories	2	Width (bays)	2	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1929	Wall Cladding Material	Hardboard siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New roof and siding. Appears to be new windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Paved driveway on right side of house. Cement path from driveway to front porch. Front porch with hip roof and white columns spans the length of the house. Wood privacy fence around backyard. Small bushes along front porch.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1211	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split Level			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1979	Wall Cladding Material	Aluminum siding	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick front porch with overhang and white columns. Bay window on front gable on second story of house on right side. White shutters on front windows. Aluminum siding around front door. Decorative eagle on front gable.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Double car attached garage on left side of the house. Short wood fence around backyard. Paved driveway leading to garage.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1500	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-French			
Number of Stories	2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)		
Year Built	1979	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Decorative brick around front windows. Decorative plaster figure on front of second floor.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Possibly new windows, new roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Expansion of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Wrought iron and brick gate around entire property. Iron gate with brick path leading to front door. Brick front porch with white railing and columns. Wood privacy fence around backyard. Bushes along base of house and base of fence. Chimney on back of house.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1514	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Commercial		1	
Current Use of Primary Building	Commercial	Historic Use of Primary Building	Commercial	
Style of Primary Bldg	Commercial style			
Number of Stories	1	Width (bays)	1	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1981	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green front double doors with side lights. Red eaves.			
Evidence of Integrity Location/Materials	Original materials on original section of house.			
Additions/Alterations to Primary Building	Multiple additions on back of house. One addition has a side gable roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Expansion of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Bushes and plants along path and base of building. Stone retaining wall along garden on left side of building. Cement path leading to front door with cement front porch with overhang. Stairs and ramp have red railings. Cement path from sidewalk leads to ramp that leads to right side of the porch. Interior chimney on left side of building.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1518	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1929	Wall Cladding Material	Vinyl siding	
Roof Shape	Hip on gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front and side of building. Front door has sidelights. Hip gable dormer on right side of house.			
Evidence of Integrity Location/Materials	Brick front porch possibly original.			
Additions/Alterations to Primary Building	Addition on the back. New siding, roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	Expansion of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Two interior chimneys on back left of Brick stairs and path leading to brick front porch with overhang and white columns. Bushes along path and front and side of house. Back porch with back door, white railings, columns, and overhang.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Parcel	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Federal			
Number of Stories	1.5	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1992	Wall Cladding Material	Vinyl siding	
Roof Shape	Saltbox	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green surround around front windows and door. Tan surround around side windows.			
Evidence of Integrity Location/Materials	All materials are most likely original since the house was built in 1992.			
Additions/Alterations to Primary Building	Addition attached by hallway in back of house.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Paved driveway on left side of the house. Paved path and brick stairs leading to front door. Bushes along front of house. Stone central chimney. Short white fence along left of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Parcel	Street	1220	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Brick	Depth (rooms)	3	
Year Built	1937	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable porch. Front gable is stucco. Blue shutters on front windows. Decorative circle on front gable.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New roof, windows, and siding.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement driveway on left side of house leading to detached garage. Bushes along base of house. Cement stairs with decorative brick ends leading to front porch with white railings and brick and white columns.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett	Survey Date	2/28/2016
ADDRESS	Street	Number	
	Parcel	Street	1224
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Bungalow		
Number of Stories	1.5	Width (bays)	3
Foundation Material	Concrete	Depth (rooms)	5
Year Built	1937	Wall Cladding Material	Vinyl siding
Roof Shape	Hip	Roof Material	Composition shingle
Decorative Details/Unique Features	Hip domer on front of roof. Extended dormer on right side of house. Semi-circle window on side of extended dormer.		
Evidence of Integrity Location/Materials	Windows in hip dormer appear original.		
Additions/Alterations to Primary Building	Addition on the back. New siding, windows, and roof.		
Condition of Primary Building	Fair	code	
		F	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Non-Contributing	code	
		N	
Other Comments / Salient Details	Chimney on back of the house. Cement stairs and path leading to front porch. Wood front porch with white railings and columns with brick bases. Bushes along front of house.		
Photo Views			
1 Front view	2 3/4 view	3	4
 			



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Parcel	Street	1226	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1948	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of house with chimney. Light blue shutters on front left window.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick path and stairs to front door. Shed roof overhang above front door with metal columns. Additional chimney on back of house. Porch on front right side of house with side door and white railing and column. Cement path leading to side porch. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine	Avenue	1517	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entranceway with tan pilasters. Tan surround around front windows with blue shutters.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on left end of house. Wood privacy fence around backyard. Paved driveway leading to attached basement garage. Brick retaining wall along left side of driveway. Brick stairs an path with iron railing leading to front door. Sun room above attached garage with flat roof and iron railing. Back door with shed roof overhang.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine Avenue		1513	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Tudor			
Number of Stories	1.5	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1947	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable entrance way with front chimney. Front gable dormer on front of house. Metal awning above front door. Front foor has curved top.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	Addition on back of building. New roof and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement driveway along right side of house leading to detached garage. Brick stairs and path with iron railing leading to front door. Bushes on either side of front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine	Avenue	1507	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family Home		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	7	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1973	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on front windows. Dark blue double double with white sunken entrance way with a white surround.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement driveway along right side of house. Brick stairs and path with iron railing leading to front door. Bushes along front of house. Central chimney. Short brick wall along right side of driveway.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine Avenue		1501	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Brick	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around door and windows. Front gable entranceway. Two front gable dormers on front of house. Dark blue shutters on front windows.			
Evidence of Integrity Location/Materials	Possibly original windows.			
Additions/Alterations to Primary Building	New siding and roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front door. Bushes along front of house. Side porch with shed roof and white railings and columns. Driveway leading to garage in back of property. Covered path from detached garage to back door. Chimney on right side of the house.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1308	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1948	Wall Cladding Material	Wood Siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Red siding. Tan surround around front door and windows.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New roof and siding.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	A lot of trees and shrubbery in the front and a brick pathway to the front door. Chimney on the back of the house. Chainlink fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne Street		1310	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1959	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Small porch with white columns, front gable on front right side of house with palladian window, brick façade, and small circular window. One front gable dormer with vinyl siding on front of house.			
Evidence of Integrity Location/Materials	Brick façade may be original.			
Additions/Alterations to Primary Building	New windows, vinyl siding, and roof. Addition on back of house.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Paved driveway along left side of the house. Brick path and stairs leading to front door. Wood fence around backyard. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1964	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Pilasters on either side of the front door			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick path and stairs leading to front door. Brick driveway on right side of the house. Bushes along front of house. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Payne	Street	1320	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1948	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on bottoms windows. White surround around front door. Two front gable dormers on front of house.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	Addition on the back of the house. New vinyl siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Paved driveway on right side. Concrete path and steps leading to front door with iron railing. A lot of landscaping including trees and bushes all around the house. Painted brick chimney on right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1324	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1964	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black windows. White surround round left windows. Front gable on right side of house. Side light on right side of door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and possibly new windows.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Central chimney. Bushes along front right side of house. Cement path leading to front door with brick stairs and iron railing.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1415	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split Level			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1955	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front windows that match front door. Tan surround around front door and windows. Front door has side lights. Front right top story has vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof, windows and vinyl siding.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path leading to front door. Overhang supported by metal column above front door. Bushes along front of house. Right end chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1407	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Carport		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal			
Number of Stories	2	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan surround around front door and windows. Windows have blue shutters.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof, appears to be new windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement driveway on right side of house. Iron railing around backyard. Brick retaining wall along sides of driveway. Brick stairs and path with brick sides leading to front door with brick stairs and iron railing. Iron lamps on either side of beginning of path leading to front door. Left end chimney. Carport in backyard. Brick steps leading to side door with shed awning on right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1405	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front dormers with vinyl siding on front of house. Dark blue shutters on front windows and door.			
Evidence of Integrity Location/Materials	Original brick siding, possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of house. Brick path and stairs with iron railing leading to front door. Bushes along front of house. Chain link fence around backyard. Cement driveway on right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1321	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1962	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows. White surround around front door.			
Evidence of Integrity Location/Materials	Original brick siding and possibly windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on right side of property. Wood fence around backyard. Bushes along foot of house. Cement path and stairs with iron railing leading to the front door. Interior chimney on right side of house and central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge		1315	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1956	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front porch with roof overhang. Large tree blocking half of the house. Wood siding on end gable.			
Evidence of Integrity Location/Materials	Original brick siding, possibly original windows.			
Additions/Alterations to Primary Building	Screened in back addition with entrance. New roof			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Brick walk to the front entrance, white brick stairs to front entrance with wood rail, stamped brick driveway, shed roof over front porch. Large tree on left side of house. Bushes along front of property. Ivy on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge	Street	1313	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Brick	Depth (rooms)	2	
Year Built	1956	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White woof siding on right side of house that used to be attached garage. Overhang above front door. White woof siding on end gables.			
Evidence of Integrity Location/Materials	Original brick siding and possibly windows on left side of house.			
Additions/Alterations to Primary Building	Addition on the back right side of the house. Attached garage was renovated into livable space. New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick retaining wall along front of property. Paved driveway on right side of house. Bushes along front of property. Cement path leading to front door with brick stairs and iron railing. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge	Street	1311	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1951	Wall Cladding Mater	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White surround and decorative brickwork around front windows. Front gable on left side of the house. Over hang over front porch with white columns and iron railing.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good			
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Dirt driveway on left side of the house. Wood privacy fence around backyard. Cement path and brick stairs and iron railing leading to front porch. Iron lamppost on front yard. Front brick chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1400	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around door and windows. Red shutters on bottom front windows. Two front gable dormers on front of house. Extended dormer on back of house.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New windows and roof. Screened in porch on left side of house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Picket fence around backyard. Screened in porch on left side of the house. Brick chimney on left end of the house. Back door with shed roof overhang. Bushes along front of house. Cement path leading to brick stairs with iron railing leading to front door.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Ave		1406	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	2.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	2004	Wall Cladding Material	Vinyl siding	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows. White surround around front door with sidelights and transom. Shed roof over front porch with white columns and railings.			
Evidence of Integrity Location/Materials	All materials most likely original since house was built in 2004.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent			code
				E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	White picket fence around frontyard. Wood privacy fence around backyard. Cement driveway on left side of house. Cement path leading from driveway to front porch. Bushes along front of white picket fence.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1410	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Dutch Colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Gambrel	Roof Material	Composition shingle	
Decorative Details/Unique Features	Gambrel roof has flared eaves. Front gable pediment porch with white columns. Dark blue shutters on front windows. White surround around front door with pilasters and triangular pediment. Vinyl siding on second story.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Addition on back of house. New windows and roof.			
Condition of Primary Building	Excellent			code E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick walkway to front entrance, brick stairs and small landing at front entrance, black iron fence around porch, chain link fenced backyard with gate, brick walk to side entrance off the front walk. Bushes along front of house. Chimney on the right end of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine		1414	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Small Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Two front gable dormers on front roof. Front gable pediment porch. Dark blue shutters on first floor windows. Dark blue plant boxes below first story windows. Lime green front door.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	Addition on the left side of the house. New windows and siding.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement driveway on the left side of the house. White picket fence around front and back yard. Cement path leading to front door with cement stairs and porch with white railings. Iron lampposts next to driveway. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Ave		1418	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinder block	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Hip on gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	One front gable dormer on front of house. Dark blue shutters on windows. Dark blue surround around front door. Decorative brickwork around windows. Front gable on left side of house.			
Evidence of Integrity Location/Materials	Original windows and original wood siding on front gable dormer.			
Additions/Alterations to Primary Building	Screened in back porch. New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick path and stairs leading to front porch with white railings and columns. Bushes along front and side of house. Wood fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4	
 				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1228	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Tudor			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1936	Wall Cladding Material	Hardboard siding	
Roof Shape	Clipped side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front door has curved top. Dark blue shutters on front windows. Front gable entrance.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New siding, roof, and windows. Addition on left side of house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Brick stairs and path with white wood railing leading to front door. Front brick chimney. Paved driveway on right side of the house. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1224	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Screened in porch on left side of the house. Overhang above front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Black lamppost on front lawn. Cement stairs and path with iron railing leading to front door with brick stairs and iron railing. Bushes along front of house. Paved driveway on right side of house. Chimney on left end of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
 				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1220	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1962	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan windows with red shutters. Tan sidelight on left side of front door. Front gable dormer on front of house. Front gable extension on front left side of house.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	New roof and appears to be new windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Wood farm fence around property. Bushes along front of house. Brick stairs and path leading to front door. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Dutch Colonial			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1951	Wall Cladding Material	Hardboard siding	
Roof Shape	Gambrel	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around windows and front door. Dark blue shutters around front windows. Extended dormer on front of house with three windows.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick path and stairs with iron railing leading to front door. Cement driveway on left side of the house leading to detached garage. Bushes along front of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split Level			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around windows. Front door has white pilasters and semi-circle pediment. Roof overhangs slightly supported by two story white columns.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Cement path leading to cement front porch. Chimney on left end of house.			



Photo Views







Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1410	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1910	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on windows. Sidelights and transom around front door. Front gable portico porch supported by two white columns above front door.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New windows, siding, and roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Brick path leading to front door with brick porch. House is currently for sale			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1412	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revial			
Number of Stories	2	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	1	
Year Built	1929	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark blue shutters on windows. Portico porch with white columns over front door. Front gable on right side of house with circular white vent.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Brick stairs and path leading to cement front porch. Brick path behind house leading to back door. Screened in porch on back of house.			
Photo Views				
1 Front view	2 Side view	3	4	
 				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1205	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Federal			
Number of Stories	2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1927	Wall Cladding Material	Hardboard siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around windows and front door. Front door has pilasters and crosshead. Dark blue shutters on front windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New siding, roof, and windows. Addition on left side of house.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Brick pathway leading to backyard. Brick path and stairs with iron railing leading to front door. Bushes along front of house. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1213	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Commercial		1	
Current Use of Primary Building	Commercial	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	7	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers with vinyl siding on original structure. Windows have dark blue shutters. Front door has pilaster and broken triangle pediment.			
Evidence of Integrity Location/Materials	Original brick siding on original structure.			
Additions/Alterations to Primary Building	Large addition on right side. New roof and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front door. Another door located on front right side of house. Chimney on left end of the house. Large lamppost in front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1221	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Famiy House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Decorative brick around front door and windows. Front gable dormer on front of house with vinyl siding. Front gable on right side of house with viny siding. Front gable entrance.			
Evidence of Integrity Location/Materials	Original brick siding. Appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front door. Bushes along front of house. Dirt driveway on right side of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

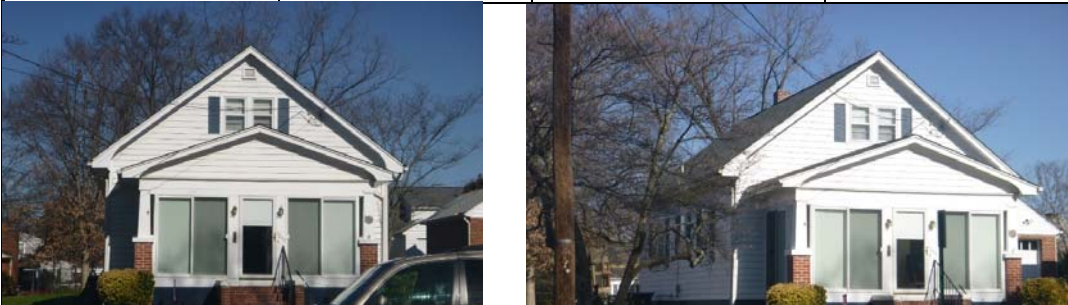

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front windows and front door. Brick front façade on front left side of house. Two dormers with curved roofs on front of building.			
Evidence of Integrity Location/Materials	Could possibly be original windows on original section of house.			
Additions/Alterations to Primary Building	Addition on back of house. New vinyl siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick retaining wall along front of property and right side of driveway. Paved driveway along left side of house leading to detached garage. Brick path and stairs with iron railing leading to front door. Central chimney. Bushes along front of house, large tree on front right of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front porch has white picket fence. Dark blue shutters on front windows. Front gable on front right side of house. Awnings over windows on left side of the house.			
Evidence of Integrity Location/Materials	Original brick siding, possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and stairs leading to front porch. Chimne on left end of house. Cement driveway along left side of house leading to detached garage. Small bushes along front of house, large tree on front right side of property.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1233	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1940	Wall Cladding Material	Hardboard siding	
Roof Shape	Front gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on windows. Front gable porch has wood columns with brick bottoms.			
Evidence of Integrity Location/Materials	Possibly original windows and siding.			
Additions/Alterations to Primary Building	Front porch has been screened in. New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front porch. Cement driveway on right side of property leading to detatched garage. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1235	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on front of house. Extended dormer on back of house. White surround around front door and windows. Blue shutters on windows.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New windows, roof, and siding. Screened in porch on right side.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	White picket fence around property. Cement path and brick stairs with iron railing leading to front door. Bushes along front of house.			
Photo Views				
1 Front view	2 Side view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine	Avenue	1405	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Aluminum siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gable on right side of house. White surround around front door. Bottom front windows have blue shutters. Front gable dormer on front of house.			
Evidence of Integrity Location/Materials	Appears to be original siding and windows.			
Additions/Alterations to Primary Building	New roof. Screened in porch on right side.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and stairs with iron railing leading to front door. Screened in porch on right side. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine	Avenue	1415	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan shutters on windows. Double front doors.			
Evidence of Integrity Location/Materials	Original brick siding and appears to be original windows.			
Additions/Alterations to Primary Building	Attached garage on left side of house was renovated into a livable space.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement stairs and path leading to cement front porch. Roof extends over porch supported by black metal columns. Paved driveway in backyard. Back door.			
Photo Views				
1 Front view	2 Side view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Augustine Avenue		1300	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Church		1	
	Shed		1	
	Building (Office)		1	
Current Use of Primary Building	Religious	Historic Use of Primary Building	Religious	
Style of Primary Bldg	Christian Church			
Number of Stories	2	Width (bays)	1	
Foundation Material	Concrete	Depth (rooms)	6	
Year Built	1970	Wall Cladding Material	Brick	
Roof Shape	Front Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White painted wood shingles on the front, red double door, wooden bell tower with copper roof and cross, wood shingle siding on front gable. Front door has white pilasters and broken triangle pediment.			
Evidence of Integrity Location/Materials	Original windows and doors with storm windows. Original wood siding.			
Additions/Alterations to Primary Building	Larger sanctuary constructed to the left, connects to the house on the right (now an office), additional building constructed in the back. New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Larger sanctuary constructed to the left; 1 story, 1 bay, 7 rooms, brick foundation, wood framed structural system, brick wall cladding, front gable roof, composite shingles, top half of the front white aluminum, broken segmental pediment with cross in the center, octagonal bell tower with copper roof and cross; original windows, large fenced in playground to right the right, asphalt parking lot behind playground. House/Office- 4 bays, 2 stories. Decoration- raised brick under second story windows, side-gable roof with composition shingles, side chimneys, concrete steps with black iron rail. Connection between House/Office and main building- archway with concrete sidewalk. Addition to main house- located in the back, brick exterior, modern pediment porch with square columns, gable roof.			
Photo Views				
1 Front view	2 3/4 view	3 3/4view	4 Side view	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge	Street	1308	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1944	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front dormer portico porch over front door with two white columns. Two front gable dormers on front of roof. White surround around front door. Front façade of house is painted brick.			
Evidence of Integrity Location/Materials	Brick façade is possibly original.			
Additions/Alterations to Primary Building	Small addition to the back left of the house. New roof, siding, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Stone retaining wall on the front of the property. House is currently undergoing renovation. Brick stairs and path leading to front porch. Gravel driveway on left side of the house.			



Photo Views







Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge	Street	1314	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1963	Wall Cladding Material	Aluminum siding	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with some kind of boarding. Brick front façade on the middle of the building.			
Evidence of Integrity Location/Materials	Original siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Concrete retaining wall in the front of the property, brick retaining wall on right side of property. Central chimney. Iron lamppost in front yard. Cement stairs and path with iron railing leading to front door. Bushes along front of house. Cement retaining wall is covered in ivy.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Dandridge	Street	1318	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-family House		1	
Current Use of Primary Building	Multi Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Split Level			
Number of Stories	3	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Decorative stone siding, glass screened front entrance, two side entrances at entry level, one entrance on second floor, dark blue shutters on windows, front balcony covered by awning, double doors and sidelights leading out to balcony.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	One huge addition to back, covered walkway connecting addition to primary. New roof, siding, and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Not compatible with surrounding styles.			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Poured concrete and decorative stone retaining wall in front, white painted cinder block wall along driveway, stairs to second story are latticed, cinder block fence with lattice and wooden gate, brick wall along poured concrete walk to right side entrance, central chimney, lamppost in yard. Ivy covering cement retaining wall.			
Photo Views				
1 Front view	2 3/4 view	3 3/4 view	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1324	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	7	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White siding on front gable on the front left side of the house. Roof hangs over porch supported by black metal column.			
Evidence of Integrity Location/Materials	Appears to be original windows, original siding.			
Additions/Alterations to Primary Building	New roof. Screened in porch on back left side of the house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front door. White fence around backyard. Central chimney.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1313	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1952	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of the house with white siding. Gable overhangs above landing supported by white column.			
Evidence of Integrity Location/Materials	Original siding, appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Bushes along path and front of house. Lamppost in front yard. Cement path and brick stairs leading to front door landing. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1309	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Brick siding is painted white. Two front gable dormers on front of house. Dark green shutters on first story front windows. White surround around front door.			
Evidence of Integrity Location/Materials	Original brick siding. Appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and brick stairs with iron railing leading to front door. Bushes line the path and front of house. Paved driveway along right side of house. Chimney on left end of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1329	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1964	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition gable	
Decorative Details/Unique Features	Two story detached barn style garage. Roof overhangs right front part of house, supported by metal columns. Dark blue shutters on front left windows.			
Evidence of Integrity Location/Materials	Original brick siding. Appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Wood privacy fence around the backyard. Cement path leading to brick landing in front of front door. Bushes along path and front of house. Interior chimney on right side of house. Back door.			
Photo Views				
1 Front view	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1325	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1964	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White surround around front door and windows. Maroon shutters on front windows that match front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Central chimney. Cement path and brick stairs leading to front door. Cement path and brick steps leading to brick landing at side door. Shed roof overhang over side door with white columns. Bushes along front of house. Wood privacy fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Brent	Street	1321	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1953	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Tan front door and windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of house. Bushes and trees along front of house. Cement path and brick stairs leading to front door. Lamppost in front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Brent	Street	1317	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Gazebo		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1951	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Black awning over front entrance. Black shutters on front windows. White surround around door and windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on the back of the house. New siding, windows, and roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Chimney on right side of the house. Paved driveway on left side of the house. Wood privacy fence around backyard. Cement path and stairs with iron railing leading to front door. Lamppost in front yard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Brent	Street	1309	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-colonial			
Number of Stories	1.5	Width (bays)	6	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Three front gable dormers on front of house. Cornice with dentils along front of house. White surround around door and windows. Pilasters and crosshead around front door. Black shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	Addition on the back of the house, new windows, and roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Wood privacy fence around backyard. Brick path and stairs with iron railing leading to front door. Bushes along front of house. Chimneys on either ends of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1300	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Dutch Colonial			
Number of Stories	2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1915	Wall Cladding Material	Hardboard siding	
Roof Shape	Gambrel	Roof Material	Slate	
Decorative Details/Unique Features	Black shutters on some of the windows. Red front door with transom. Meta hip roof overhang above front porch with white columns.			
Evidence of Integrity Location/Materials	Possibly original windows on main section of house.			
Additions/Alterations to Primary Building	Addition on back of house. New roof and siding.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement path lined with bushes leading to front porch. Chimney on left end of main house and back end of addition. Short brick wall around backyard. Paved driveway in backyard. Hallway connection main house to addition. Addition has gambrel roof and two front gable dormers. Addition has exterior door near driveway.			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	College	Avenue	1314	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
	Guest House?		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Dutch colonial			
Number of Stories	2	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	4	
Year Built	1904	Wall Cladding Material	Hardboard siding	
Roof Shape	Gambrel	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable poritco over front door with checkered pattern walls. Front door has sidelights. Black shutters on windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on back of house. New roof, siding, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	Growth of UMW			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	White picket fence around property. White archway above brick path and stairs leading to brick front porch. Sunroom on left side of house with flat roof and white iron railing. Driveway on back right side of property leading to possible guest house. Back door and garden. Bushes along base of house			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4 Rear 3/4 view	
 				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1212	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Asbestos shingle	
Decorative Details/Unique Features	Blue shutters on front windows. Sidelight on left side of the front door. White siding on gable ends.			
Evidence of Integrity Location/Materials	Original brick siding, roof, and windows.			
Additions/Alterations to Primary Building	Deck on back of house.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Attached garage on left side of house. Brick retaining wall along property line. Cement driveway leading to attached garage. Cement path and stairs with iron railing leading to front door. Short brick wall along path leading from driveway to front door. Interior chimney on left side of the house. Lamppost on front lawn.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1220	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1929	Wall Cladding Material	Hardboard siding	
Roof Shape	Hip	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Dark blue shutters on front windows. Hip gable dormer with three small windows at top of front of house. Hip roof over front porch with white columns. White surround around front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on back of house. New roof, siding, and windows.			
Condition of Primary Building	Excellent			code
				E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	Two interior chimneys. Cement driveway on left side of house. Cement path leading to brick steps and brick front porch. Attached garage at back of house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1224	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on left side of house with white wood siding has small circular window. Gable overhangs above front door with brick and white column. Dark blue shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of house. Paved driveway on left side of house. Lamppost in front yard. Brick planters along front of house. Cement path from driveway to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Dandridge	Street	1228	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White shutters on front windows. Roof hangs over front door.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of house. Bushes along front of house. Paved driveway along left side of house. Cement path and brick stairs with iron railing leading to front door. Wood fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine Avenue		1319	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	7	
Year Built	1939	Wall Cladding Material	Hardboard siding	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Two front gable dormers on the front of the house. Yellow siding. Decorative stone around front door. Front gable portico over front door that extends with the roof that covers the front porch.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Large addition on back of house with front gable roof. Attached garage on back of house with flat roof New roof, siding, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Two interior chimneys on right side of original part of house. Brick path leading to cement stairs and front porch. Two dormers on left side of the house with low pitch gable roofs. Gravel driveway leading to attached garage. Side door on right side of house.			
Photo Views				
1 3/4 vie	2 Side view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Augustine	Avenue	1317	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1951	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on windows. Black storm door over front door. Siding is painted white brick.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of house. Cement path leading to brick stairs and porch with iron railing. Lamppost on front lawn. Brick driveway on left side of the house. Wood fence around backyard.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1233	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-Colonial			
Number of Stories	2.5	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Three front gable dormers on front of house with white siding. Dark blue shutters on windows. White surround around front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Brick path and stairs with iron railing leading to front door. Bushes along front of house. Interior chimney on left side of house.			
Photo Views				
1 Front view	2 3/4 view	3 Side view	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1229	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1953	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on front of house. Dark green shutters on first story front windows. White surround around windows. Sidelights and transom around front door.			
Evidence of Integrity Location/Materials	Possibly original windows.			
Additions/Alterations to Primary Building	Addition on back left side of house. New siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Central chimney. Carport attached to left side of house. Cement driveway on left side of house leading to carport. Cement path and stairs with iron railing leading to front door.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Bungalow			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable dormer on right side of the house. White surround around front door and windows. Wood front porch with hip roof. Columns have painted white brick on bottom.			
Evidence of Integrity Location/Materials	Original windows.			
Additions/Alterations to Primary Building	New roof and possibly new siding.			
Condition of Primary Building	Fair		code	
			F	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Bushes along front and side of house. White picket fence around backyard. Paved driveway on left side of the house. Side door on left side of the house with hip roof.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1221	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1964	Wall Cladding Material	Vinyl siding	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on front windows that match front door and side door. White surround around front door and windows.			
Evidence of Integrity Location/Materials	None.			
Additions/Alterations to Primary Building	New siding, roof, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path and stairs leading to front door. Cement driveway on left side of the house. Side door on left side of the house. Bushes along front of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Brent	Street	1217	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1933	Wall Cladding Material	Hardboard siding	
Roof Shape	Side gable	Roof Material	Slate	
Decorative Details/Unique Features	Snowbreakers on front of roof. Dark blue shutters on front door and windows. White surround around front door and windows.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	Addition on back, attached garage on left. New roof, siding, and windows.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Central chimney. Cement path and brick stairs with iron railing leading to front door. Bushes along front of house. Paved driveway on left side of house leading to garage attached to main house by hallway.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Payne	Street	1225	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Mixed Style			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1961	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Double porch with hip roof and white columns and railings. Appears to have been recently renovated.			
Evidence of Integrity Location/Materials	Brick siding on first floor may be original.			
Additions/Alterations to Primary Building	New roof, windows, and vinyl siding.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Paved driveway on left side of house. Cement retaining wall along front and left side of property. Cement path leading to brick double porch with white columns and white railing on the second story. Porch has hip roof.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	2/21/2016
ADDRESS	Street		Number	
	Stafford Ave		1509	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-family House		1	
Current Use of Primary Building	Multi-family	Historic Use of Primary Building	Single family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	1.5	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Asbestos shingles	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Red surround around windows and front door.			
Evidence of Integrity Location/Materials	Original siding and appears to be original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Brick walkway to the front door, concrete driveway to the left. Side entrance has a shed overhang. Chimney on right end of house. Large trees and shrubs block view of the house.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	2/28/2016
ADDRESS	Street		Number	
	Parcel	Street	1216	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Mixed Style			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Side gable porch extends to attached carport. Dark blue shutters on front windows. White vinyl siding on front gable.			
Evidence of Integrity Location/Materials	Original siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code
				N
Other Comments / Salient Details	Cement driveway on right side of house leading to carport. Bushes along front of house. Cement path leading to front porch with white railings and columns. Central chimney.			
Photo Views				
1 Front view	2 3/4 view	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1404	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1952	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Black shutters on front windows to the right of the front door. Attached basement garage on left side of house.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Paved driveway on left side of the house leading to basement attached garage. Cinderblock and brick retaining wall along either side of the driveway. Cement stairs and path with iron railing leading to front door. Bushes along path, driveway, and front of house. Lamp post in front yard. Central chimney.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1408	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Front gable portico with wood siding and white columns over front landing.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Cement driveway along left side of house. Cement stairs with iron railing and path leading to bricks stairs and landing in front of front door. Bushes along front of house. Lamp post in front yard. Chimney on left end of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Srafford Avenue		1414?	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1950	Wall Cladding Material	Stone	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers with vinyl siding on front of the house. Front gable on right side of the house. Large shrubs, trees, and a lot of ivy cover the front yard.			
Evidence of Integrity Location/Materials	Original stone siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	<p>Stone and cement retaining walls on either side of the driveway.</p> <p>Paved driveway on right side of the house leads to basement attached garage. Cement stairs and path with iron railing leading to front door. Large shrubs and trees block the left side of the house.</p> <p>Sun room on right side of the house. White privacy fence around backyard.</p>			
Photo Views				
1 Front View	2 3/4 View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford Avenue		1416	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1946	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on the front of the house with vinyl siding. Green shutters on windows on front of the house. Extended dormer with vinyl siding on rear of house. White pilasters and crown around front door. Decoartive brick lintel above windows.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	Addition with vinyl siding on left side of the house with a shed roof. New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on left end of the house. Paved driveway on left side of the house leads to basement attached garage. Brick retaining wall along each side of the driveway. Cement steps and path with iron railing leading to front door. Wood picket fence around backyard. Cement stairs and path leading to back door. Bushes along front and side of house.			
Photo Views				
1 Front View	2 Side View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Payne	Street	1408	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1961	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Sunken in front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick path and stairs with iron railing leading to front door. Bushes along front and side of house. Chimney on the left end of the house.			
Photo Views				
1 Front View	2 3/4 View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Payne	Street	1416	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	1	
Year Built	1966	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White siding around front door. Tan shutters on front left windows. Tan paneling underneath front left windows.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimney on front middle of the house. Cement path leading to front door.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Payne	Street	1414	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Overhang above front porch with white columns and decorative white archways. Dark blue shutters on front door and right front windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Interior chimney on left side of house. Cement driveway on left side of the house. Brick path leading to cement front porch. Bushes along front and side of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Payne	Street	1424	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1961	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White shutters on front door and left front window.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Bushes along front of house and path. Cement path and brick stairs with iron railing leading to front door. Interior chimney on right side of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Payne	Street	1428	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split Level			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White crown and pilasters around front door. Sidelights on either side of the front door. Hip roof portico with white supports above front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Gravel driveway on left side of the house. Cement path starting half way through the front yard leading to cement steps leading to front door. Bushes along front of house. Wood stairs and railing leading to second story entrance on left side of the house.			
Photo Views				
1 Front View	2	3	4	
				

Name of Surveyors	Kimberly Packett	Survey Date	3/12/2016
ADDRESS	Street	Number	
	Dandridge Street	1417-1427	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Apartment Complex	1	
Current Use of Primary Building	Apartment Complex	Historic Use of Primary Building	Apartment Complex
Style of Primary Bldg	Apartment Complex		
Number of Stories	3	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	8
Year Built	1969	Wall Cladding Material	Brick
Roof Shape	Side Gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Vinyl siding on second story and gable ends. Brick siding on first story and ends of structures. Apartments facing towards the parking lot on second story have cement balconies with iron railings. Main doors have white crown and pilasters.		
Evidence of Integrity Location/Materials	Original siding and windows.		
Additions/Alterations to Primary Building	Most likely a new roof.		
Condition of Primary Building	Fair	code F	
Observable Threats	Poor, surrounding buildings are predominantly single family homes.		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Non-Contributing	code N	
Other Comments / Salient Details	Paved driveway in between buildings. Brick stairs with iron railing lead to main entrance doors in the center of each building. First story apartments have rear entrances with brick stairs and iron railings.		

Photo Views

1 3/4 View




2 3/4 View





3 3/4 View

4 3/4 View





Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1411	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neocolonial			
Number of Stories	2	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Aluminum Siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Dark green shutters on front windows and front door. Second story juts out further than first story in the front of the house.			
Evidence of Integrity Location/Materials	Possibly original siding. Original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Cement driveway on right side of the house. Cement stairs and path with iron railing leading to front door. Bushes along front and side of house. Chimney on left end of the house. Shed in the backyard.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1409	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White crown and pilasters around front door. Black shutters on front windows. Large tree blocks the left side of the house.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Fair	code		
		F		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Brick retaining wall along front of the property and driveway. Cement driveway on left side of the house. Wood privacy fence around backyard. Brick stairs with iron railing and path leading to front door. Brick stairs leading to front door has white railing. Cement and brick path from the driveway to the front door. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett	Survey Date	3/12/2016
ADDRESS	Street	Number	
	Stafford Avenue	1400	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Shed	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Minimal Traditional		
Number of Stories	1	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1955	Wall Cladding Material	Brick
Roof Shape	Side gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Front gable in center of house has vertical tan wood and stone siding. Tan surround around front door.		
Evidence of Integrity Location/Materials	Original brick siding.		
Additions/Alterations to Primary Building	Addition on rear of house has vinyl and brick siding. New windows and roof.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code C	
Other Comments / Salient Details	Cinderblock retaining wall along side of property. Cement stairs leading to backyard on left side of the property. Brick path and stairs leading to front door with iron railing. Central chimney. Hedges along back of house. Shed in the backyard. Chain link fence around backyard.		

Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1312	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1959	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	White painted brick on front of house. Vinyl siding on front gable and other sides of the house. Black shutters on windows.			
Evidence of Integrity Location/Materials	Original windows and brick siding.			
Additions/Alterations to Primary Building	Addition on rear of house. New vinyl siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	White picket fence around front yard. Central chimney. Cement driveway on right side of the house. Cement path and stairs with iron railing leading to front door from the sidewalk. Bushes along base of house and white picket fence. Interior chimney on rear addition.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett	Survey Date	3/12/2016
ADDRESS	Street	Number	
	Brent Street	1401	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Minimal Traditional		
Number of Stories	2	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	6
Year Built	1954	Wall Cladding Material	Brick
Roof Shape	Hip	Roof Material	Composition shingle
Decorative Details/Unique Features	Green shutters on windows. Roof overhangs above front porch supported by white column. Skylight on addition on rear of house.		
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows on original part of building.		
Additions/Alterations to Primary Building	Large addition on rear of structure with vinyl siding. New roof.		
Condition of Primary Building	Excellent	code E	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Fair, large addition doesn't fit with surrounding structures.		
Potential NR Eligibility	Non-Contributing	code N	
Other Comments / Salient Details	Wooden privacy fence around backyard and half of front yard. Cement driveway leading to basement attached garage on right side of the house. Two interior chimneys. Cement path and bricks stairs leading to front door. Bushes along front of house. Lamp post in front yard.		

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1413	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Vertical wood siding on front gable. Stone siding on front center of house. Red front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Central chimney. Sunroom on rear of house. Cement retaining wall along right side of the property. Cement path and brick stairs and porch with iron railing leading to front door. Lamp post in front yard. Bushes along front and side of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1417	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows. Side door on right side of house with brick stairs.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on right side of house. Lamp post on front yard. Cement path leading from sidewalk and brick steps with iron railing leading to front door. Bushes along front and side of house. Chimney on right end of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1423	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front windows. White surround around front door. Roof hangs over front door landing supported by decorative metal iron support.			
Evidence of Integrity Location/Materials	Appears to be original windows.			
Additions/Alterations to Primary Building	New siding and roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Dirt and gravel driveway on right side of the house. Cement path leading from sidewalk to cement stairs leading to front door. Central chimney.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett	Survey Date	3/12/2016
ADDRESS	Street	Number	
	Brent Street	1425	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Bldg	Split Level		
Number of Stories	1	Width (bays)	4
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1957	Wall Cladding Material	Brick
Roof Shape	Shed	Roof Material	Composition shingle
Decorative Details/Unique Features	Green shutters on front second story windows and side windows. Side door on left side of house.		
Evidence of Integrity Location/Materials	Original brick siding and windows.		
Additions/Alterations to Primary Building	New roof.		
Condition of Primary Building	Good	code G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Fair, more modern style than surrounding houses.		
Potential NR Eligibility	Non-Contributing	code N	
Other Comments / Salient Details	Dirt and gravel driveway on right side of the house. Cement path leading from driveway to front door. Bushes and trees along front of house.		

Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1426/1428	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Front Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable portico with vertical wood siding over front landing supported by iron posts. White shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, most surrounding houses are single family homes.			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement path from sidewalk to brick stairs with iron railing leading to front door. Bushes along front of house. Dirt driveway on right side of house. Chain link fence and wood privacy fence around backyard. Side door on right side of house, appears to be original door and entranceway.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1424.1422	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neocolonial			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Brick/Hardboard siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on front second story windows. Hardboard siding on second story, brick siding on first story. White pilasters and crowns with dentils around front doors. Second story hangs over first story slightly.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, most surrounding houses are single family homes.			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Bushes along front of the house. Skinny brick path leading from sidewalk to both front doors. Chainlink fence around backyard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1418	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split Level			
Number of Stories	2 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Aluminum siding	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on front second story windows. Aluminum siding on top most story. Brick siding on bottom and middle story. Front gable on right side of the house.			
Evidence of Integrity Location/Materials	Original siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Chainlink fence around property. Cement driveway on right side of the house. Bushes along front of chainlink fence in front of house. Cement path leading from driveway to front door.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1412/1414	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1959	Wall Cladding Material	Vinyl siding	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan shutters on front and side windows.			
Evidence of Integrity Location/Materials	Original windows.			
Additions/Alterations to Primary Building	New roof and siding.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, most surrounding houses are single family homes.			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement path leading from sidewalk to brick stairs with iron railing leading to front door. Chainlink fence around sides and back of property. Small bushes along front of house.			
Photo Views				
1 Front View	2 3/4 View	3	4	

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1408a and 1408b	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Multi-Family House		1	
Current Use of Primary Building	Multi-Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	6	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Fair			code F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, most surrounding houses are single family homes.			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Chainlink fence around back and side of property. Cement path and stairs from sidewalk to front doors on left side of the house. Small bushes along front of house. Cement path leading from sidewalk to back door.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Roof extends over front porch with multiple white columns. Front gable in front center of house.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof. Addition on back of house.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement path leading from sidewalk to brick stairs and front porch. Central chimney and interior chimney on addition. Garden and small bushes along front of the house.			
Photo Views				
1 Side View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1400	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1955	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Black shutters on front and side windows. Horizontal siding on gable end, front gable, and addition on right side of house.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	New windows and roof. Vinyl siding on front gable, side gable, and below windows on right side of the house.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement driveway leads to basement attached garage on front right side of the house. Brick retaining wall along left side of the driveway. Cement stairs and path with iron railing leading to front door from sidewalk. Lamp post in front yard. Ivy on either side of path.			
Photo Views				
1 Side View	2 Front View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1408	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1955	Wall Cladding Material	Aluminum siding & Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Brick siding on bottom half of front of house and aluminum siding on top half of house and other sides. Roof hangs over front door landing supported by white support.			
Evidence of Integrity Location/Materials	Original siding and windows			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Paved driveway on left side of the house. Cement stairs and path with iron railing leading to front door. Brick steps with iron railing leading to front door. Lamp post in front yard. Bushes along front of house. Central chimney.			

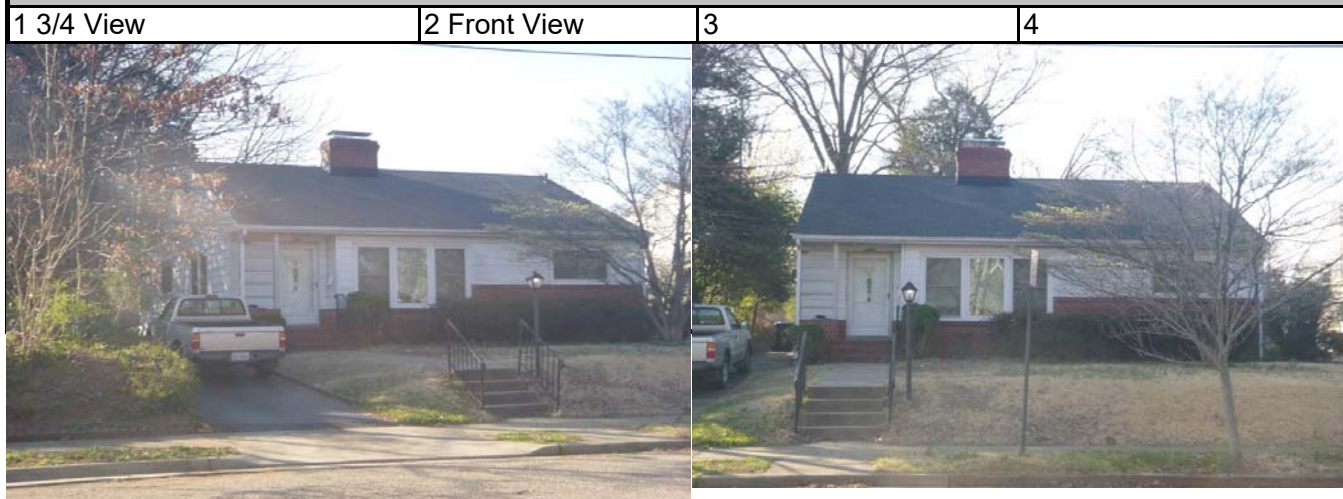Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1412	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Middle, front of house protrudes and has brick siding. Front gable has vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows, new vinyl siding, and new roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Paved driveway on the left side of the house leading to shed, cement stairs up hill on right side of the property. Cement pathway to brick stairs leading up to small cement porch in front of front door. Porch surrounded by iron railings. Lamppost on front lawn covered in ivy, lawn covered in ivy. Bushes along front of house. Central chimney.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1416	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gable in middle of house. Blue shutters on front door and front windows.			
Evidence of Integrity Location/Materials	Original brick siding, windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick stairs and path with iron railing leading from sidewalk to front door. Lamp post on front law. Bushes along front of house. Central chimney.			
Photo Views				
1 3/4 View	2 Front View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1420	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	2	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Roof hands over front landing supported by white column. Front gable with vinyl siding.			
Evidence of Integrity Location/Materials	Original windows and brick siding			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement steps and path leading from sidewalk to front door. Lamp post in front lawn. Brick planter along front right of house. Chimney on left end of house. Bushes along front of house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1424	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Split level			
Number of Stories	2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1959	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Vinyl siding on second floor. Black shutters on windows. Sidelights on either side of front door. Side gable roof on left side of house, hip roof on right side of house.			
Evidence of Integrity Location/Materials	Original windows and brick siding			
Additions/Alterations to Primary Building	Attached garage on right converted into a living space. New vinyl siding and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Brick retaining wall along left side of front door, cement pathway from sidewalk to front door, bushes along front of house. Central chimney.			

Photo Views

1 3/4 View	2 3/4 View	3 Side View	4
------------	------------	-------------	---



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1208	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Front gable on left side of the house. White pilasters and crown around front door. Green shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Brick stairs and path with iron railing leading to front door. Chimneys on either end of the house. Sun room on right side of the house. Bushes along front of the house.			


Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford Avenue		1204	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1954	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Black shutters on front windows. White pilasters and crown around front door.			
Evidence of Integrity Location/Materials	None			
Additions/Alterations to Primary Building	New vinyl siding, roof, and windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Stone retaining wall along front and left of property and left side of driveway. Cement driveway on right side of the house. Brick stairs and path with iron railing leading to front door. Chimney on right end of house. Sunroom on the rear of the house. Small bushes along front of the house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1200	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	5	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows and front door. Front center gable with horizontal siding and decoartive white circular vent. Brick front porch with roof overhang supported by white supports.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement path leading from sidewalk to brick stairs and landing with iron railing leading to front door. Bushes along front of house. Interior chimney.			
Photo Views				
1 Front View	2	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1200	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1	Width (bays)	4	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1956	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White shutters on front white windows. Front gable on right front of house.			
Evidence of Integrity Location/Materials	Original brick siding and possibly original windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Bushes along the front of the house. Cement path leading from sidewalk to brick stairs with iron railing leading to front door. Sunroom on rear of the house. Chimney on left end of the house.			

Photo Views



1 Side View	2 Front View	3	4
-------------	--------------	---	---



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1204	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1948	Wall Cladding Material	Vinyl siding	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Dentils along front of house. Black shutters on front windows and front door. White surround around front door.			
Evidence of Integrity Location/Materials	Dentils appear to be original.			
Additions/Alterations to Primary Building	Two story addition on back of house, new vinyl siding, new windows, and new roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick path leading from sidewalk to front door. White picket fence around left side of property. Green privacy fence around backyard. White shed in backyard. Interior chimney on back of the house. Short stone wall along front of the house. Side door on left side of the house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1208	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Two front gable dormers on front of house with wood siding. White shutters on front first story windows. White pilasters and crown around front door. Roof hands over front door slightly.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof. New vinyl siding on gable ends.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement path leading from sidewalk to brick stairs with iron railing leading to front door. Small bushes along front of house. Cement steps leads to side door on left side of house with roof overhang and white railing. Chimney on right end of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1302	
TYPE & NUMBER OF BLGS & STRUCTURES	Augustine		Number	
	Single Family House		1	
	Detatched Garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Stone	
Roof Shape	Side gable	Roof Material	Slate	
Decorative Details/Unique Features	Three front gable dormers on front of house with vinyl siding. Tan crown and pilasters around front door.			
Evidence of Integrity Location/Materials	Original stone siding and possibly original windows and roof.			
Additions/Alterations to Primary Building	Rear addition with vinyl siding.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Chimneys on either end of the house. Dirt and gravel driveway leading to detached garage in back of the property. Cement path leading from sidewalk to brick stairs with white railing leading to front door. Sun room on left side of the house.			

Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1308	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	1952	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable portico with four columns above front door. Front door has sidelights on either side of the front door and semi-circular transom above the front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick path and stairs leading to front door from the sidewalk. Paved driveway on right side of the house. Cement path from driveway to side door on right side of the house with brick stairs and iron railing. Overhang above side door entrance. Small bushes and garden along front of house. Chimney on right end of house.			

Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Sidelights and transom around front door. Roof hangs over front door landing with white support. Wood siding on gable ends.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Gravel driveway on right side of house. Cement path leading from driveway to front door. Ivy along left side of driveway and left side of property. Garden with bushes along front of the house. Interior chimney.			
Photo Views				
1 Front View	2 3/4 View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford Avenue		1217	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	2	Width (bays)	4	
Foundation Material	Brick	Depth (rooms)	2	
Year Built	1948	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	White lintel with keystone on main house first story windows. White pilasters and crown around front door. Two front gable dormers with white vinyl siding. Blue shutters on first story front windows.			
Evidence of Integrity Location/Materials	Original brick siding. Original windows on main house.			
Additions/Alterations to Primary Building	New roof. Attached garage is addition along with hallway attaching garage to main house.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Black iron fence around yard. Brick path leading from sidewalk to brick stairs with iron railing leading to front door. Chimney on right end of house. Attached garage is attached by a section with vinyl siding. Bushes along front of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1213	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Red shutters on center front window. Front gable on center front of house. Vertical white siding on front center gable.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Central chimney. Brick and cement stairs and path leading from sidewalk to front door with iron railings.			



Photo Views





Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1209	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1951	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on the front of the house with blue vinyl siding. White pilasters and crown around front door. Black shutters on first story front windows.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Brick stairs and path with iron railings leading to front door. Bushes along front of house. Chimney on left end of the house.			

Photo Views





Name of Surveyors	Kimberly Packett	Survey Date	3/12/2016
ADDRESS	Street	Number	
	Stafford Avenue	1205	
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number	
	Single Family House	1	
	Shed	1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family
Style of Primary Blg	Minimal Traditional		
Number of Stories	1	Width (bays)	3
Foundation Material	Cinderblock	Depth (rooms)	2
Year Built	1962	Wall Cladding Material	Brick
Roof Shape	Side Gable	Roof Material	Composition shingle
Decorative Details/Unique Features	Roof hangs over front porch with 5 white columns.		
Evidence of Integrity Location/Materials	Original brick siding and windows.		
Additions/Alterations to Primary Building	New roof.		
Condition of Primary Building	Good	code	
		G	
Observable Threats	None		
Compatibility with Adjacent Land Uses	Good		
Potential NR Eligibility	Contributing	code	
		C	
Other Comments / Salient Details	Cement steps and path with iron railing leading from sidewalk to brick stairs with iron railing and front porch in front of front door. Bushes along front of house. Chimney on right end of house. Lamp post in front yard.		
Photo Views			
1 Front View	2 3/4 View	3	4
			

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1325	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1962	Wall Cladding Material	Brick, wood siding	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White wood paneling underneath front left windows. Left side window and front windows on left side of the house have green shutters. Window on the front right side of the house has green and white shutters. White wood paneling on center section of the house where the front porch is. Roof hangs over front porch with white supports. Two front doors.			
Evidence of Integrity Location/Materials	Original siding on original portion of house.			
Additions/Alterations to Primary Building	Addition on the right side of the house, new windows, new roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on left side of the house. Cement stairs and path with iron railing leading to central front door. Small bushes along front and side of house. Chimney on right end of house and central chimney. Brick stairs with iron railing leading to door on the front right side of the house.			
Photo Views				
1 Side View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street	Number		
	Royston Street	1321		
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
	Shed	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1964	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front door has sidelights on either side. Whole doorway has white pilasters and crown around it. Black shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	New roof and windows. Sun porch addition on left side of house.			
Condition of Primary Building	Excellent		code	
			E	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Small bushes and garden along front of house. Sunroom on left side of the house. Central chimney. Brick stairs and path leading from sidewalk to front door.			
Photo Views				
1 3/4 View	2 Front View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1317	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Colonial Revival			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1956	Wall Cladding Material	Brick	
Roof Shape	Gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	White pilasters and crown around front door. Black shutters on front window. Decorative brick lintel on first story front windows.			
Evidence of Integrity Location/Materials	Original brick siding			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Wood privacy fence on right side of the property. Concrete driveway on right side of house. Bushes along front of house and walkway. Lamp post in front yard. Brick stairs with iron railing and path leading from sidewalk to front door. Chimneys on either end of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1313	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Detached garage		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	1.5	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	150	Wall Cladding Material	Stone	
Roof Shape	Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Green shutters on first story front windows. Two front gable dormers with vinyl siding on front of house.			
Evidence of Integrity Location/Materials	Possibly original stone siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Cement driveway on right side of the house leads to detached garage in backyard. Stone path and steps with iron railing leading from sidewalk to front door. Chimney on right side of house.			

Photo Views


1 3/4 View

2 Front View

3

4





Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Rappahannock Avenue		1209	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1965	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows. Roof hangs over front door landing supported by white column. Front gable on front right side of house. Horizontal aluminum siding on front gable.			
Evidence of Integrity Location/Materials	Original brick siding. Possibly original windows.			
Additions/Alterations to Primary Building	Carport addition on left side of house. New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement driveway on the left side of the house leading to attached carport. Small bushes along front of house. Cement steps and path leading to front door with iron railing. Chimney on left end of house. Decorative pineapples on small brick wall around property.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1429	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingles	
Decorative Details/Unique Features	Dark green shutters on front left side of the house. Two front doors. Tan siding on former attached garage.			
Evidence of Integrity Location/Materials	Original brick siding and original windows on original part of the house.			
Additions/Alterations to Primary Building	Attached garage on the right side of the house was converted into a livable space. New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Bushes along front of house. Chimney on right side of the house. Cement path and steps leading to door on the right side and front porch with iron railing.			

Photo Views




Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1427	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1957	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable with horizontal siding on center front of the house. Green shutters on front of the house.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Paved driveway on left side of the house. Cement path from leading from sidewalk to brick stairs with iron railing leading to front door. Small bushes and garden along the front of the house. Chimney on left side of the house. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1415	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	4	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Cross gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red picket fence shutters on front windows. Sidelight on right side of front door with white paneling. White siding on front gable.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Paved driveway on left side of the house leading to attached garage. Cement path leading to front door. Cement path and steps with iron railing leading from driveway to back door. Central chimney. Bushes and garten along base of house.			

Photo Views

1 3/4 View	2 Front View	3	4
------------	--------------	---	---



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Colony	Road	1200	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gable on right side of house with wood siding. Black shutters on front windows. Roof hangs over front porch supported by white support.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Cement driveway on right side of house. Brick path and stairs with iron railing leading from the sidewalk to the front door. Chimney on left end of the house. Bushes along the front of the house. Wood privacy fence around backyard. Cement path from driveway to brick path.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Colony	Road	1202	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1960	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Three front gable dormers on front of house with wood siding. Black shutters on first story windows on main building. Transom above front door. Front gable portico with white columns over front landing.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof. Addition on back right side of the house.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Cement driveway on right side of the house flanked by two decorative pineapples. Brick path and stairs leading from sidewalk to front door. Brick path leading from driveway to main brick path. Small bushes along front of house. Chimneys on either end of original house.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Colony	Road	1208	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Asbestos shingle	
Decorative Details/Unique Features	Transom above front door. White pilasters on either side of front door. Blue shutters on first story front windows. Two front gable dormers on front of house with wood siding.			
Evidence of Integrity Location/Materials	Original brick siding. Possibly original windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Bushes and gardens along front of house and front of property. Chimney on left end of the house. Cement path and brick stairs with iron railing leading from sidewalk to the front door.			



Photo Views






Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1222	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Sidelights on either side of the front door. Front gable on the left side of the front of the house with vertical siding. Extended dormer with vinyl siding on the back of the house. Roof extends over front porch supported by white beams.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Sunroom with vinyl siding on the left side of the house with an accessible patio on the roof. Chimney on the left end of the house. Bushes along the front and sides of the house. Brick retaining wall along the left side of the property. Lamp post on the front lawn. Brick path and stairs with iron railing leading from sidewalk to brick front porch.			
Photo Views				
1 Side View	2 Front View	3	4	



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1230	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1949	Wall Cladding Material	Vinyl Siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Red shutters on the front windows. White surround around front windows and front door. Front gable portico above front porch with white beams. Front gable portico with white beams over side door.			
Evidence of Integrity Location/Materials	Possibly the brick chimney and windows.			
Additions/Alterations to Primary Building	New vinyl siding and roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	
			C	
Other Comments / Salient Details	Chimney on right end of the house. Cement driveway on right side of the house. Cement stairs and path with iron railing leading to front door. Bushes along the front of the house. Side door on the right side of the house with front porch with white beams and railing and front gable portico.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1232	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1950	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Green shutters on left front window. Front door flanked by a tree on either side. Brick planter along the front right side of the house. Front gable on the front left side of the house with vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Chimney on the right side of the house. Brick stairs and path leading from sidewalk to the front door.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1101	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	6	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1965	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Black shutters on front windows on original section of house. Addition on the left side of the house with vinyl siding and a bay window. Roof hangs over front porch supported by white beams. White paneling below front original windows.			
Evidence of Integrity Location/Materials	Original brick siding. Original windows on original section of the house.			
Additions/Alterations to Primary Building	Addition on the left side of the house with vinyl siding. New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Cement driveway on right side of the house leading to attached carport. Stone path leading from sidewalk to brick steps leading to front porch. Small bushes and garden along front of house. Interior chimney on right side of the house. Lamp post in front lawn.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1111	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1974	Wall Cladding Material	Stone	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Front gables on either end of the front of the house. Small courtyard to the left of the front door. Double green french doors.			
Evidence of Integrity Location/Materials	Original stone siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	
			G	
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	
			N	
Other Comments / Salient Details	Cement driveway and stairs leading from sidewalk to front door. Lamp post on front lawn. Cement driveway on left side of the house leading to attached garage. Bushes along the front and the right of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				


Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1201	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Neo-Mediterranean			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1974	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Roof extends over the front porch with brick wall archway on the right side of the porch. Sidelight on the right side of the front door.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, style doesn't fit in neighborhood.			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Painted white brick wall along the front of the property. Cement driveway on the left side of the house leading to attached garage. Stone steps and path leading from sidewalk to front door. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street	Number		
	Stafford Avenue	1101		
TYPE & NUMBER OF BLGS & STRUCTURES	Type	Number		
	Single Family House	1		
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Black shutters on front windows.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing	code		
		C		
Other Comments / Salient Details	Brick retaining wall along front of the property and stairs leading to path. Cement driveway on the right side of the house. Cement stairs and path leading from sidewalk to front door. Lamp post in front yard. Central chimney. Cement stairs with iron railing leading to sidedoor. Small bushes along front of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford Avenue		1109	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1962	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows. Front gable on left front side of the house. Front gable hangs over front door.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Brick retaining wall along front of property and on either side of driveway. Cement driveway on left side of the house leading to basement attached garage. Brick stairs and path with iron railing leading from sidewalk to front door. Bushes along front of house. Chimney on right end of the house. Lamp post on front lawn.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Stafford	Avenue	1117	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Blg	Cape Cod			
Number of Stories	2	Width (bays)	3	
Foundation Material	Concrete	Depth (rooms)	5	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Tan and red striped awning above front door. Blue shutters on front first story windows. Red shutters on side windows on addition. Two front gable dormers on the front of the house. Attached basement garage. Large addition on rear of house with front gable roof and vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding and windows on original section of house.			
Additions/Alterations to Primary Building	Large addition on rear of the house with vinyl siding. New roof.			
Condition of Primary Building	Good			code
				G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code
				C
Other Comments / Salient Details	Brick retaining wall along front and side of property. Cement driveway on left side of the house leading to attached basement garage. Wood picket fence around the backyard. Bushes and garden along front and side of house. Brick stairs and path with iron railing leading from sidewalk to front door. Sun room on right side of the house.			
Photo Views				
1 Front View	2 Side View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1316	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Ranch			
Number of Stories	1	Width (bays)	5	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1963	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition Shingle	
Decorative Details/Unique Features	Sidelights on either side of the front door. Red shutters on front windows. Tan paneling below window on front left side. Tan siding around front door. Carport attached to rear of house.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof.			
Condition of Primary Building	Good		code	G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing		code	C
Other Comments / Salient Details	Brick retaining wall along front of the property. Paved driveway on left side of the house leading to attached carport on rear of the house. Paved path leading from driveway to brick stairs and front porch. Wood privacy fence along back of backyard. Garden at foot of driveway and along front of house.			
Photo Views				
1 Front View	2 3/4 View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1312	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1 1/2	Width (bays)	5	
Foundation Material	Brick	Depth (rooms)	4	
Year Built	2002	Wall Cladding Material	Vinyl siding	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Blue shutters on front windows. Transom and sidelights around front door. Front gable hangs over front porch with white column supports. Palladian window on front gable.			
Evidence of Integrity Location/Materials	All original materials.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Excellent		code	E
Observable Threats	None			
Compatibility with Adjacent Land Uses	Fair, newer construction and landscape makes it stand out in the neighborhood.			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Paved driveway on right side of the house. Cement path that leads from driveway to back of house. Brick path and stairs that lead from driveway to brick front porch with white railings and columns. Black iron fence on left side of property. Wood privacy fence on right side of property. Large garden in front of house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Royston	Street	1300	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Minimal Traditional			
Number of Stories	1	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1958	Wall Cladding Material	Brick	
Roof Shape	Side gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Roof hangs over front porch supported by white beams. White surround around windows. Attached double garage on the right side of the property with vinyl siding. Addition on left side of house with side door and vinyl siding.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	Attached garage is an addition. New roof.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Central chimney. Cement driveway on right side of the property that leads to attached double garage. Cement path and stairs leading from sidewalk to brick front porch. Chimney on rear of house. Garage is attached to main house by covered walkway. Shed in back left side of backyard. Cement path leading to left side door.			



Photo Views



Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1104	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
	Shed		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Craftsman			
Number of Stories	1 1/2	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	1971	Wall Cladding Material	Brick	
Roof Shape	Front Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Double front gable roof. White shutters on front windows. Roof hangs over front door landing supported by white column. Brick siding on first and middle floor. hardboard siding on second story.			
Evidence of Integrity Location/Materials	Original brick siding and windows.			
Additions/Alterations to Primary Building	New roof and hardboard siding.			
Condition of Primary Building	Good	code		
		G		
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing	code		
		N		
Other Comments / Salient Details	Chimney on right end of the house. Bushes along front and right side of the house. Cement driveway on left side of the house. Brick stairs with iron railing leading from driveway to front door. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Brent	Street	1238	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	American Foursquare			
Number of Stories	2	Width (bays)	2	
Foundation Material	Concrete	Depth (rooms)	2	
Year Built	1917	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	White pilasters on either side of front door with a white broken pediment above it.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New windows and roof.			
Condition of Primary Building	Fair		code	F
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement retaining wall along right side of property. Cement steps and path leading from sidewalk to wood steps and landing with wood railing in front of front door. Central chimney. Stairs leading to basement entrance on the back right side of the house.			
Photo Views				
1 Side View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Colony	Road	1206	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Postmodern			
Number of Stories	1	Width (bays)	3	
Foundation Material	Cinderblock	Depth (rooms)	3	
Year Built	2009	Wall Cladding Material	Brick	
Roof Shape	Hip	Roof Material	Composition shingle	
Decorative Details/Unique Features	Cement circular portico above front porch. Window on front second story behind top of circular portico. Semi-circular cement wall on left side of building with cubed window.			
Evidence of Integrity Location/Materials	All original materials.			
Additions/Alterations to Primary Building	None.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing			code N
Other Comments / Salient Details	Cement driveway along the left side of the house. Cement path and brick stairs leading from driveway/sidewalk to the front door. Small bushes and trees along front of house. Lamp post in front yard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Dandridge	Street	1407	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Postmodern			
Number of Stories	1 1/2	Width (bays)	2	
Foundation Material	Concrete	Depth (rooms)	3	
Year Built	2008	Wall Cladding Material	Vinyl Siding	
Roof Shape	Cross Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Palladian window on front gable. Roof hangs over porch to the right of the attached garage where the front door is located.			
Evidence of Integrity Location/Materials	All original materials			
Additions/Alterations to Primary Building	None			
Condition of Primary Building	Excellent		code	E
Observable Threats	Poor, does not match surrounding styles.			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Non-Contributing		code	N
Other Comments / Salient Details	Cement driveway leading to attached garage in the front of the house. Cement stairs with white railing leading from driveway to porch. Chainlink fence around backyard.			
Photo Views				
1 3/4 View	2 Front View	3	4	
				

Name of Surveyors	Kimberly Packett		Survey Date	3/12/2016
ADDRESS	Street		Number	
	Augustine Avenue		1102	
TYPE & NUMBER OF BLGS & STRUCTURES	Type		Number	
	Single Family House		1	
Current Use of Primary Building	Single Family	Historic Use of Primary Building	Single Family	
Style of Primary Bldg	Cape Cod			
Number of Stories	1 1/2	Width (bays)	4	
Foundation Material	Cinderblock	Depth (rooms)	2	
Year Built	1954	Wall Cladding Material	Brick	
Roof Shape	Side Gable	Roof Material	Composition shingle	
Decorative Details/Unique Features	Two front gable dormers on the front of the house. Roof hangs over front porch supported by white columns with brick bottoms and white railing.			
Evidence of Integrity Location/Materials	Original brick siding.			
Additions/Alterations to Primary Building	New roof and windows.			
Condition of Primary Building	Good			code G
Observable Threats	None			
Compatibility with Adjacent Land Uses	Good			
Potential NR Eligibility	Contributing			code C
Other Comments / Salient Details	Chimney on left end of the house. Sunroom on the left side of the house with white railing along the roof. Cement path and brick stairs leading from the sidewalk to the front porch. Garden along the front of the house.			
Photo Views				
1 3/4 View	2 Front View	3	4	
